



PD-C
PD-CS

English
עברית

1

44



PD-C

PD-CS

en	Original operating instructions	1
he	הוראות הפעלה מקוריות	44

1 Information about the documentation

1.1 About this documentation

- Read this documentation before initial operation or use. This is a prerequisite for safe, trouble-free handling and use of the product.
- Observe the safety instructions and warnings in this documentation and on the product.
- Always keep the operating instructions with the product and make sure that the operating instructions are with the product when it is given to other persons.

1.2 Explanation of symbols used

1.2.1 Warnings

Warnings alert persons to hazards that may occur when handling or using the product. The following signal words are used in combination with a symbol:

	DANGER! Draws attention to an imminent hazard that will lead to serious personal injury or fatality.
	WARNING! Draws attention to a potential hazard that could lead to serious personal injury or fatality.
	CAUTION! Draws attention to a potentially dangerous situation that could lead to minor personal injury or material damage.

1.2.2 Symbols in the documentation

The following symbols are used in this document:

	Read the operating instructions before use
	Instructions for use and other useful information

1.2.3 Symbols in the illustrations

The following symbols are used in illustrations:

2	These numbers refer to the corresponding illustrations found at the beginning of these operating instructions.
3	The numbering reflects the sequence of operations shown in the illustrations and may deviate from the steps described in the text.
(11)	Item reference numbers are used in the overview illustration and refer to the numbers used in the key in the product overview section.
	This symbol is intended to draw special attention to certain points when handling the product.

1.3 Laser information on the product

Laser information

 <p>LASER RADIATION DO NOT STARE INTO BEAM CLASS 2 LASER PRODUCT</p> <p>Wavelength: 635 nm Maximum output power: 1mW This product complies with IEC 60825-1: 2007 and 21 CFR 1040.10 and 1040.11 Except for deviations pursuant to Laser Notice NO.50, date June 24, 2007</p>	Laser radiation. Do not stare into the beam. Class 2 laser.
--	---

1.4 Declaration of conformity

We declare, on our sole responsibility, that the product described here complies with the applicable directives and standards. A copy of the declaration of conformity can be found at the end of this documentation.

The technical documentation is filed here:

Hilti Entwicklungsgesellschaft mbH | Tool Certification | Hiltistrasse 6 | D-86916 Kaufering, Germany

1.5 Product information

Hilti products are designed for professional use and may be operated, serviced and maintained only by trained, authorized personnel. This personnel must be informed of any particular hazards that may be encountered. The product and its ancillary equipment may present hazards when used incorrectly by untrained personnel or when used not as directed.

- Write down the serial number in the table below. You will be required to state the product details when contacting Hilti Service or your local Hilti organization to enquire about the product.

Product information

Type:	PD-C PD-CS
Generation:	01
Serial number:	

2 Safety

2.1 Basic information concerning safety

CAUTION

Possible hazard or risk of electric shock or burning injuries! Attempting to remove the battery presents a risk of electrical hazards, e.g. short circuiting, burning injuries and leakage of harmful substances.

- Do not attempt to open the product. Have the battery replaced only by **Hilti** Service.



CAUTION

Possible hazard or risk of electric shock or burning injuries! Ingress of liquids such as rainwater, dew or condensation, etc. into the product presents a risk of electrical hazards, e.g. short circuiting, burning injuries and explosion.

- ▶ Keep the product clean and dry at all times.
 - ▶ Keep the hinged cover cap closed to prevent dampness entering the interior of the product.
-



CAUTION

Possible hazards as result of short circuiting, overload and fire. Possible hazards due to heat radiation, ejection of molten material or chemical reactions caused by short circuiting, overloading or through resulting fire.

- ▶ Do not expose the product to high temperatures or fire. The battery contained in the tool could explode or release toxic substances.
 - ▶ Use only the approved USB AC adapter with standard micro-USB cable.
 - ▶ Under abusive conditions, liquid may be ejected from the battery. Avoid contact with this liquid. Rinse with water if contact occurs. In the event of eye contact with the liquid, a doctor should also be consulted. The liquid that leaks from a battery may cause skin irritation or burns.
-



WARNING

Warning: hazardous high-frequency or low-frequency electromagnetic radiation! Electromagnetic radiation may cause spontaneous activation/starting. The emission of radiation may cause interference to other devices.

- ▶ Do not use the product in the proximity of persons who have a cardiac pacemaker.
 - ▶ Do not use the product in the proximity of medical instruments and appliances.
 - ▶ Operation of the product in the proximity of military installations, airports, radio astronomy facilities or in aircraft is not permissible unless prior permission has been obtained.
-



CAUTION

Visible and invisible laser radiation present hazards. Looking into the laser beam causes eye damage.

- ▶ Secure the area in which you will be taking measurements. Take care to avoid directing the laser beam toward other persons or toward yourself when setting up the product.
 - ▶ Do not look directly into the light source. In the event of direct eye contact with the laser beam, close your eyes and move your head out of the path of the laser beam.
 - ▶ Keep laser tools out of reach of children.
-

CAUTION

Unintentional activation of the laser beam presents a hazard. The laser beam may be switched on by inadvertently pressing a measure command button or by a software error.

- ▶ Avoid unintentional activation of the laser beam.
 - ▶ When handling the product, always bear in mind that the laser beam could be switched on inadvertently. Before looking toward the path of the laser beam, make sure that the laser beam is switched off or that the product is switched off completely.
-

WARNING

Risk of explosion! Operation in the vicinity of flammable liquids, gases or dusts is hazardous.

- ▶ Pay attention to the ambient conditions. Do not use the product where there is a risk of fire or explosion.
-

Possible measurement errors Measurement errors are possible when the operating temperature range is not observed, when there is a high concentration of particles in the air, when the lens is dirty, when measurements are taken from unsuitable surfaces or when the product is used incorrectly.

- ▶ After switching on and while using the product, always pay attention to the information and warnings displayed on the touchscreen.
 - ▶ Check the accuracy of the product before using it for measuring.
 - ▶ When the product is brought into a warm environment from very cold conditions, or vice-versa, allow it to become acclimatized before use.
-

Incorrect settings may have damaging consequences. Incorrect settings, e.g. due to use of a measuring extension of a different length, may lead to incorrect results and consequential damage.

- ▶ Always pay attention to the information and warnings displayed on the touchscreen.
 - ▶ Make sure that you use the correct settings when taking measurements.
-

In addition to the safety rules listed in the individual sections of these operating instructions, the following rules must be strictly observed at all times. The product and its ancillary equipment may present hazards when used incorrectly by untrained personnel or when used not as directed.

- ▶ Keep all safety instructions and information for future reference.
- ▶ Stay alert, watch what you are doing and use common sense when working with the product. Do not use the product while you are tired or under the influence of drugs, alcohol or medication. A moment of inattention while operating the product may result in serious personal injury.
- ▶ Do not render safety devices ineffective and do not remove information and warning notices.
- ▶ If the product is opened improperly, laser radiation in excess of Class 2 may be emitted. **Have the product repaired only by Hilti Service.**
- ▶ Tampering with or modification of the product is not permitted.
- ▶ Check that the product functions correctly each time before use.

- ▶ Measurements taken from surfaces with low reflectivity in highly reflective surroundings may be inaccurate.
- ▶ Measurements taken through panes of glass or other objects may be inaccurate.
- ▶ The measurement may be incorrect if the conditions under which the measurement is taken change rapidly, e.g. due to people walking through the path of the laser beam.
- ▶ Do not point the product toward the sun or other powerful light sources.
- ▶ The product and its ancillary equipment may present hazards when used incorrectly by untrained personnel or when used not as directed.
- ▶ To avoid the risk of injury, use only genuine **Hilti** accessories and additional equipment.
- ▶ Observe the information printed in the operating instructions concerning operation, care and maintenance.
- ▶ Never use the product without having received the appropriate instruction on its use or without having read this documentation.
- ▶ Due to the principle employed, the results of measurements may be negatively affected by the surrounding conditions. This includes, e.g. close proximity to equipment that generates powerful magnetic or electromagnetic fields, taking measurements from unsuitable surfaces and use of unsuitable reflectors.
- ▶ Measurements to plastic foam surfaces, e.g. polystyrene foam, to snow or to highly reflective surfaces, etc. may result in incorrect readings.

2.2 Proper preparation of the working area

- ▶ Avoid unfavorable body positions when working from ladders. Make sure you have a safe stance and that you stay in balance at all times.
- ▶ Secure the site at which you are taking measurements and take care to avoid directing the laser beam toward other persons or toward yourself.
- ▶ Use the product only within its specified limits. Do not direct the laser beam toward mirrors, stainless steel, polished stone or similar surfaces.
- ▶ Keep the laser exit window clean in order to avoid measurement errors.
- ▶ Observe the accident prevention regulations applicable in your country.

2.3 Electromagnetic compatibility

Although the laser range meter complies with the strict requirements of the applicable directives, **Hilti** cannot entirely rule out the possibility of interference to the laser range meter caused by powerful electromagnetic radiation, possibly leading to incorrect operation. Accuracy must be checked by taking measurements by other means when working under such conditions or if you are unsure. Likewise, **Hilti** cannot rule out the possibility of interference with other devices (e.g. aircraft navigation equipment). The laser range meter complies with the requirements of class A: The possibility of interference occurring in a domestic environment cannot be excluded.

2.4 Working safely with laser tools

- ▶ Laser Class 2 tools may be operated only by appropriately trained persons.
- ▶ Laser beams should not be projected at eye height.
- ▶ Precautions must be taken to ensure that the laser beam does not unintentionally strike highly reflective surfaces.
- ▶ Precautions must be taken to ensure that persons do not stare directly into the beam.
- ▶ The laser beam must not be allowed to project beyond the controlled area.
- ▶ Switch the laser tool off when it is not in use.
- ▶ Activate the locking function in the tool settings in order to prevent unauthorized persons, especially children, from activating the laser beam.


- ▶ Store laser tools, when not in use, in places to which unauthorized persons have no access.

2.5 General safety rules

- ▶ Check the product for damage before use. Have the damage repaired by **Hilti** Service.
- ▶ Before using the product, just to be sure, check the product's preset settings and any settings you have made yourself.
- ▶ Do not use the product while you are driving a vehicle or operating a machine.
- ▶ Check the accuracy of the product after it has been dropped or subjected to other mechanical stresses.
- ▶ Although the product is designed for the tough conditions of jobsite use, as with other measuring instruments it should be treated with care.
- ▶ Although the product is protected against the entry of moisture, it should be wiped dry before being put away in its transport container.
- ▶ Store tools and appliances out of reach of children when not in use. Do not allow persons who are unfamiliar with the product, or with these instructions, to operate the product. Tools or appliances are dangerous in the hands of untrained, inexperienced persons.

3 Introduction to the tool

3.1 Product overview

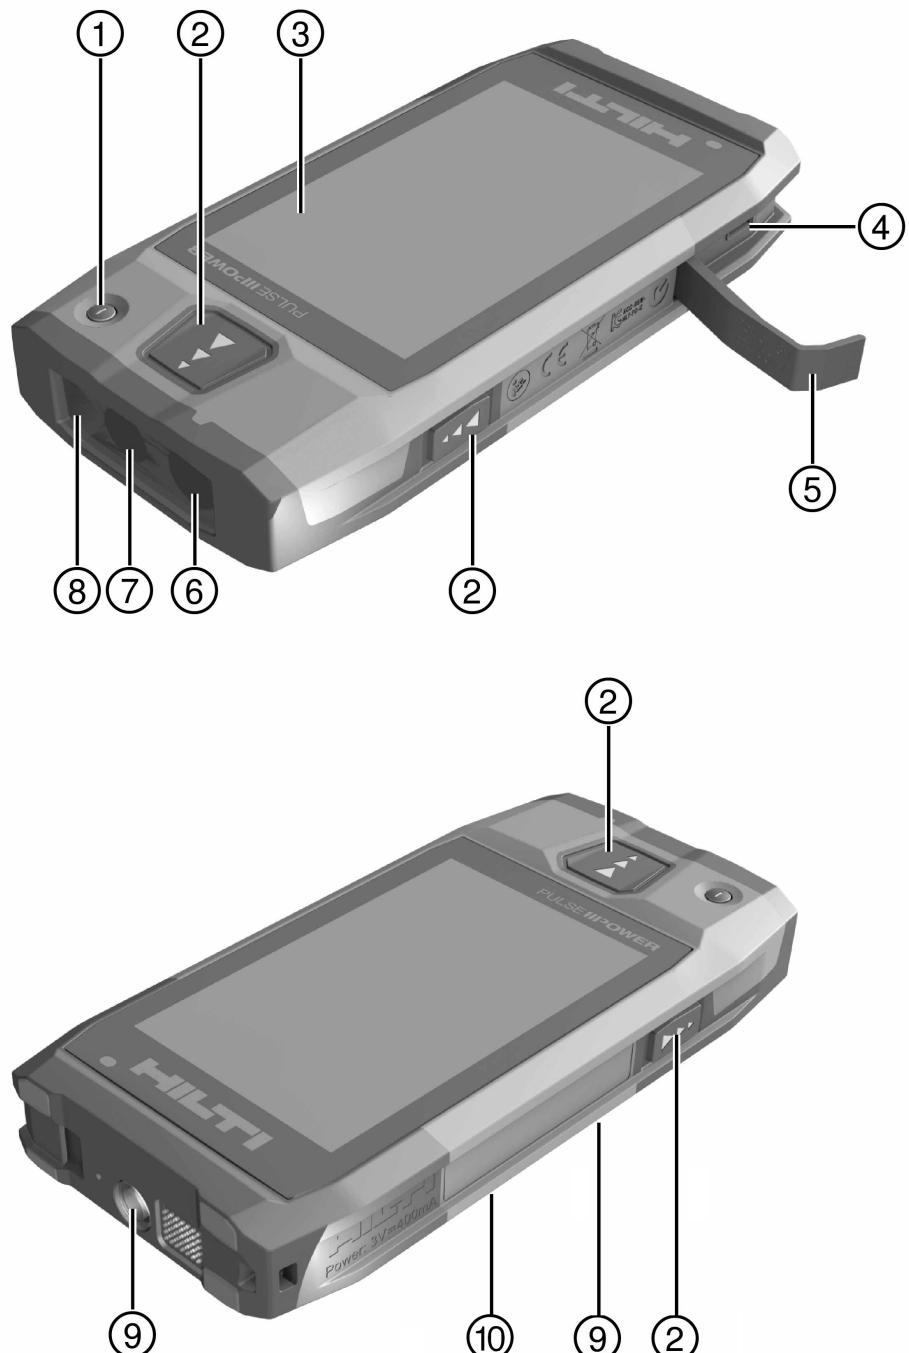

① On/off switch

② Measure command buttons

- | | |
|----------------------------|----------------------------------|
| ③ Touchscreen | ⑦ Camera lens |
| ④ Micro-USB socket, type B | ⑧ Glass cover |
| ⑤ Hinged cover | ⑨ Tripod thread |
| ⑥ Laser exit window | ⑩ Image-recording camera (PD-CS) |

3.2 Intended use

The product described is a laser range meter. It is designed to be used for measuring distances. The measured distances can be used in conjunction with a wide range of calculation functions, e.g. areas, volumes, minimum/maximum distances, Pythagoras calculations, laying out, etc.

3.3 Items supplied

Laser range meter, wrist strap, soft pouch, short measuring extension, power supply unit with micro-USB cable.

Other system products approved for use with this product can be found at your local **Hilti Store** or online at: www.hilti.group.

3.4 Integrated battery

The product comes with a permanently integrated 3220 mAh Li-ion battery.

The Li-ion battery will typically last for 500 full charging cycles or at least two years of moderate to heavy use.

When the battery is discharged, the charging operation lasts for roughly three hours – provided that the USB cable and plug adapter supplied by **Hilti** are used.



If, at the start of the charging operation, the battery was completely or almost completely discharged, the charging signal may only appear after roughly 30 minutes.

At temperatures over 30 °C (86 °F), the time required to charge the battery will increase considerably. Optimal battery charging times are achieved at normal interior temperatures, away from direct sunlight.

In the case of very high exterior temperatures, i.e. 32 °C (90 °F) and over, the charging operation will take longer. The charging operation may even be automatically interrupted in order to maintain a safe battery temperature.

The charging operation may take longer if the USB cable supplied by **Hilti** is connected to a PC for charging.

We do not recommend using micro-USB cables from other manufacturers. If this cannot be avoided, you should first ensure that the cable in question is suitable for use with 5.0 V/2.1 A power sources. The time required to charge the tool may be significantly increased if a different make of micro-USB cable is used. If a micro-USB cable from another manufacturer is regularly used in place of the one supplied by **Hilti**, this may impair the battery life.

- ▶ When starting the tool for the first time, ensure that the battery is completely charged before putting the tool into operation.
- ▶ Do not charge the tool in direct sunlight.
- ▶ If the charging operation stops or is taking a very long time, try to find a cooler environment in which to charge the battery.
- ▶ If there is anything unusual about the battery charging operation or if the battery life falls below two hours, contact your **Hilti** Service team.

- ▶ The tool should only be charged using the micro-USB cable supplied by **Hilti**. Connect the cable to a USB port on a PC or, using the plug adapter supplied, a power outlet.
- ▶ If you lose the micro-USB cable or the plug adapter supplied with the tool, contact your **Hilti** Service team for a replacement.



WARNING

Risk of injury caused by the laser beam. Failure to follow the correct procedures when opening may cause uncontrolled emission of laser radiation.

- ▶ Always have repairs carried out by **Hilti** Service.

- ▶ The Li-ion battery must be replaced by **Hilti** Service as the tool has to be reconfigured once the battery has been replaced.

3.5 Technical data

3.5.1 Distance measurement



Note

Distance and inclination measurement accuracy: Influences such as sharp temperature fluctuations, moisture, shock, dropping, etc. can affect accuracy. Unless otherwise stated, the tool was adjusted or calibrated under standard ambient conditions (MIL-STD-810G). As a basic principle, when taking distance measurements allow for an additional distance-dependent error of 0.02 mm per meter. The reference for inclination measurements is the rear face of the tool.

	PD-C	PD-CS
Operating modes	<ul style="list-style-type: none"> • Single measurements • Range (multiple) measurements 	<ul style="list-style-type: none"> • Single measurements • Range (multiple) measurements
Distance measurement accuracy (2σ, standard deviation)	± 1.0 mm	± 1.0 mm
Inclination measurement accuracy (2σ, standard deviation)	$\pm 0.3^\circ$	$\pm 0.3^\circ$
Beam divergence	0.20 mrad ... 0.45 mrad	0.20 mrad ... 0.45 mrad
Measuring range with target plate	0 m ... 200 m (0 ft ... 656 ft)	0 m ... 200 m (0 ft ... 656 ft)
Minimum distance for aiming with the laser point and cross hairs without use of the zoom function	> 2 m (> 6 ft - 10 in)	> 2 m (> 6 ft - 10 in)
Minimum distance for aiming with the laser point and cross hairs at the maximum zoom setting	> 5 m (> 16 ft)	> 5 m (> 16 ft)

3.5.2 Touchscreen

Indicators	Continuous display of distance, operating status and battery charge status
Touchscreen diagonal size	10.16 cm (4.00 in)

3.5.3 Power supply

Li-ion battery	Built-in
Rated voltage	3.7 V
Capacity	3,220 mAh
Standby time	> 200 h
Length of time until the automatic sleep mode is activated	20 min
Battery life under normal operating conditions, display switched on	≈ 10 h
Charging time (depending on battery charger and charging cable)	≈ 3 h
Battery charger input voltage	100 V ... 240 V
Battery charger input frequency	50 Hz ... 60 Hz
Battery charger rated current	0.5 A
Battery charger output voltage	5 V
Charging current	10 mA ... 2,100 mA
Charging cable plug standard	Micro-USB

3.5.4 Laser

	PD-C	PD-CS
Laser class	Visible, laser class 2, IEC/EN 60825-1:2007; Class 2 CFR 21 § 1040 (FDA)	Visible, laser class 2, IEC/EN 60825-1:2007; Class 2 CFR 21 § 1040 (FDA)
Wavelength	635 nm	635 nm
Output power	< 1 mW	< 1 mW
Time until activation of power-saving mode	20 s	20 s

3.5.5 Other characteristics of the product

	PD-C	PD-CS
Internal flash memory capacity for saving measurements	≈ 3,000 Note The value given is based on typical direct measurements with target photo. The actual maximum depends on the type of measurements and the resolution of the photos.	≈ 7,000 Note The value given is based on typical direct measurements with target photo. The actual maximum depends on the type of measurements and the resolution of the photos.
Aiming camera maximum resolution [megapixels]	5.0	5.0
Image-recording camera [megapixels]	5.0	5.0
Bluetooth version	2.1 + EDR (3 Mbit/s)	2.1 + EDR (3 Mbit/s)
Wireless LAN	•/•	Complies with the standard: IEEE 802.11 b/g/n, supported channels: 1 - 11
Bluetooth transmitting power	12.3 dBm	15.39 dBm
Wireless LAN transmitting power	•/•	18.47 dBm
Frequency	2,400 MHz ... 2,483.5 MHz	2,400 MHz ... 2,483.5 MHz
Weight	260 g (9.2 oz)	260 g (9.2 oz)
Dimensions	154 mm × 75 mm × 24 mm (6.1 in × 3.0 in × 0.9 in)	154 mm × 75 mm × 24 mm (6.1 in × 3.0 in × 0.9 in)
Protection class	IP54	IP54
Operating temperature	-15 °C ... 50 °C (5 °F ... 122 °F)	-15 °C ... 50 °C (5 °F ... 122 °F)
Storage temperature	-15 °C ... 50 °C (5 °F ... 122 °F)	-15 °C ... 50 °C (5 °F ... 122 °F)

3.6 Basic principle

The tool determines the distance along a laser beam emitted by the tool to the point at which the beam strikes a reflective surface. The red laser spot ensures that the target is clearly identifiable. The range is dependent on ambient light levels as well as the reflectance and structure of the target surface from which measurements are taken.

3.7 Navigating on the display

3.7.1 Preparations at the workplace

CAUTION

Risk of injury! Inadvertent starting of the product.


- ▶ Remove the battery before making any adjustments to the power tool or before changing accessories.

Observe the safety instructions and warnings in this documentation and on the product.

3.7.2 Start page

The tool's start page contains links to the following pages:

- Measuring application
- Project folder list within the measuring application
- 'Draw in picture' function within the measuring application
- Tool settings
(Please note: The settings for the measuring application can be found in the '**Application Settings**' menu, in the '**Functions**' drop-down list within the measuring application)
- system apps, including the camera for photos and videos, a gallery in which photos and videos can be viewed and a pocket calculator.

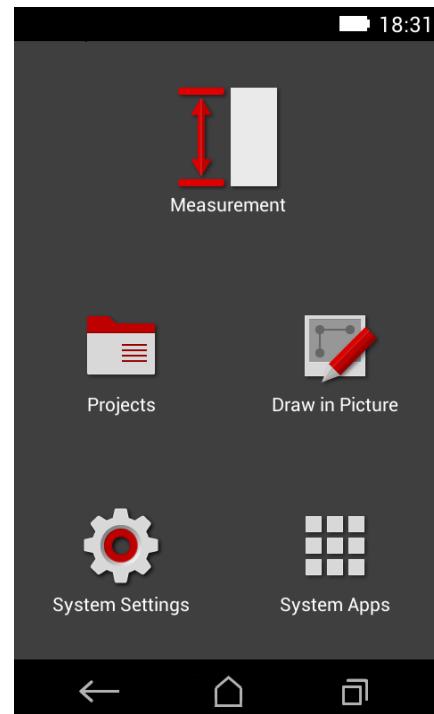


3.7.3 Measuring application

The measuring application is the main application for taking measurements. It offers a range of measuring functions, some of which are supported by assistants. The measuring application saves the measurements in project folders which you can export and transfer to other devices via Bluetooth (PD-C and PD-CS) and via WLAN (PD-CS).

The measuring application's main page contains the following:

- The project folder list; this is displayed by tapping the active project shown at the top, in the center of the menu bar.
- The **results list for the active project**; starting with the most recent result, this shows all of the measurements in chronological order, with the oldest result at the

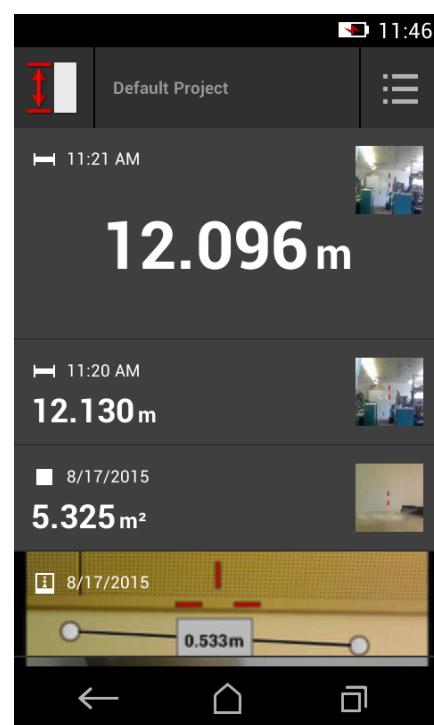

end of the list. Details relating to a specific result can be displayed by tapping it.

- The  icon for the ‘**Functions**’ drop-down menu; this is located in the upper-right corner of the display. The drop-down menu contains all of the measuring functions (see the overview of functions, → page 17), and the ‘**Application Settings**’ menu with the settings for the measuring application can be found at the end of the list.

3.7.4 Toolbar

The toolbar is displayed during the measurement. It allows you to activate assistants, switch between the permanent laser and the standard laser, switch on the aiming camera and change the reference position.



3.7.5 Navigation bar

The navigation bar is always found at the lower edge of the display, and includes the following elements:



-  End a function and return to the previous view or the last menu displayed.
-  Return to the start page.
-  Display all active applications and end or select individual ones.

3.8 Buttons and icons for triggering and ending measurements

After switching on the laser, a measurement can always be taken using one of the three rubber measure buttons. For the majority of the functions, you can also take measurements using the measure button icon on the display once the tool is in position and ready to measure.

If you take a measurement when the range is shown before the measurement is triggered, you can take the measurement by tapping on the displayed range. In the case of range (multiple) measurements, you can also end the measurement by tapping on the displayed distance.



Note

Pressing one of the three measure buttons will take you directly to the ‘**Direct**’ function.

3.8.1 Ending measurements and functions

You can end any measurement or function using .

3.9 Inclination sensor

The inclination sensor incorporated in the PD-C and PD-CS allows calculations to be made using indirect measurements. The integrated inclination sensor measures the horizontal inclination. In order to achieve greatest possible accuracy when making inclination measurements, the inclination sensor must be adjusted at regular intervals. Observe the instructions given in the tool software relating to regular adjustment. You

must also adjust the tool after it has been exposed to a change of temperature or if it has been subjected to an impact.

The tool is not designed for taking precise angle measurements. We recommend you use a spirit level or a suitable precision tool for this purpose.

3.10 Measuring aids

3.10.1 Measuring extension PDA 72

The PDA 72 measuring extension is made from aluminum and is equipped with a non-conductive synthetic rubber grip. If the PDA 72 measuring extension (optional accessory) is screwed onto the base of the tool, a dialog appears in which you have to confirm selection of the measuring extension. The PDA 72 measuring extension can also be screwed to the rear of the tool.

3.10.2 Short measuring extension

The product package contains a short measuring extension (folding spike). This folding spike is designed to allow you to work with points of reference in places otherwise inaccessible to the flat base of the tool.

The folding spike is helpful when measuring diagonally across rooms or when points of reference are hard to access. Observe the notes on optimizing measuring accuracy → page 31.

- ▶ The folding spike should be regularly used in certain indirect and Pythagoras measurements to retain the same point of reference for all partial measurements.
- ▶ Insert the folding spike into the holder on the tool cover for safe storage.

In its original condition, the folding spike has a rounded end. Long-term use of the folding spike may result in abrasion of this point.

- ▶ If the folding spike has been flattened by use, or if you have lost the folding spike, please contact **Hilti** Service.

3.10.3 Fitting a measuring extension to the base of the tool




Note

A measuring extension will be detected automatically (and taken into account accordingly) only when a genuine **Hilti** PDA 74 measuring extension (short version for the PD-C and PD-CS, supplied with the product) or a genuine **Hilti** PDA 72 measuring extension (long version for the PD-I, PD-E, PD-C and PD-CS, available separately) is screwed into the base of the tool.

Other extensions or tripods may also be used. When one of these is screwed into the base of the tool, you must then carefully determine the offset distance and manually enter this value in the tool.

1. Switch the tool on and unlock the display.
2. Screw the measuring extension into the base of the tool.
 - You will be requested to make a selection.
3. Select the matching measuring extension or enter the offset distance.

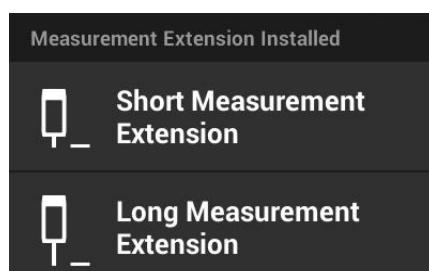

3.10.4 Target plates

For larger ranges and in unfavorable light conditions, we recommend use of the PDA 50, PDA 51 or PDA 52 target plates.

For reliable measurements, care should be taken to ensure that the laser beam strikes the target plate at right angles, as far as possible.

Note

When the PDA 50 and PDA 52 target plates are used and very high accuracy is required, add a value of 2 mm (0.1 inches) to the measurement obtained.

This distance value can be entered manually. Select the **D** reference setting before or after the measurement and enter a numerical offset of 0.0025 m or $\frac{1}{16}$ inches.

3.10.4.1 Target plate PDA 50

The PDA 50 target plate is made of durable plastic with a special reflective coating. Use of the target plate is recommended at distances greater than 10 m in unfavorable light conditions.

3.10.4.2 Target plate PDA 51

The PDA 51 target plate has no reflective coating and its use is recommended in unfavorable light conditions and at shorter distances.

3.10.4.3 Target plate PDA 52

The PDA 52 target plate is equipped with the same reflective coating as the PDA 50 but is considerably larger in size (210 x 297 mm). This makes it much easier to aim the tool at the target plate over long distances.

3.11 Measuring very short distances

The shortest distance that the tool can reliably measure under typical operating conditions is 15 cm (US: 6 inches). However, the minimum spacing for a reliable surface can be up to 1.5 m if the target has a non-reflective color or surface, such as dark black, or a smooth, velvety surface structure. If the measurement is not reliable, the tool will not display a result.

3.12 Measuring accuracy

The accuracy of the laser distance measurement, from the tool's reference position to the laser spot, is determined with a maximum deviation of 1.0 mm. If a target cannot be reached or bright sunlight does not permit this level of precision, no result is displayed.

Measuring accuracy when using the '**Indirect**', '**Pythagoras**' and '**Picture**' functions may, under typical operating conditions and without careful use of a tripod, lie significantly beyond ± 1.0 mm. The deviation depends on how exactly you retain the reference position for each of the measurements required to calculate the end result. Continuous use of the short measuring extension makes it easier to swivel the tool around a single, unchanged starting point. On the other hand, rotating the tool without using a measuring extension or a tripod will often cause slight deviation from the exact reference position.

The measuring accuracy when using the '**Picture**' function depends on whether the tool is positioned at an exact angle of 90° to the target (at both horizontal and vertical right angles) and on whether the whole surface surveyed in the target picture is genuinely level, such as a facade or a ceiling. The following table shows the typical deviations for measurements in photos when the photo was not taken from a 90° angle.

Errors caused by surveying from a position not at right angles to the wall

The following table presupposes that the vertical 90° angle against the wall is maintained using the inclination indicator on the range meter.

The data on error percentages in the table estimates the deviation of the measurement in relation to the corresponding real distance.

Limitations

- Individual adjustment of tools is not taken into account.
- Values apply to freehand measurements.
- If a tripod is used, the accuracy is increased by approximately 0.5%.

	Length of the line drawn on the screen in relation to the width of the screen (without zoom)		
Deviation from the horizontal 90° angle against the wall	< 30%	30% to 50%	> 50% to 100%
0°	±4.5%	±2.5%	±2.2%
maximum ±3°	±5.2%	±3.7%	±4.9%

3.12.1 ‘Picture’ for advanced users

If the procedure is carried out with due care, aiming the laser at a horizontal or vertical line at a 90° angle allows advanced users to use the ‘**Picture**’ function to determine a distance along the line. This method must be used with caution, as all of the distances determined in the picture that do not lie along a line surveyed at a 90° angle will be significantly less accurate.

3.12.2 The influence of surfaces on the measurement

The **Hilti** laser module, developed on the basis of PulsePower (millions of pulses per second), offers the best conditions for reception of an ample number of distinct samples of reflected laser light, which are used to calculate precise measurements.

However, there are situations in which the tool will not receive a sufficient amount of reflected light from the target. Understanding this principle means that certain remedies are possible, such as the use of target plates from **Hilti**, available as an accessory. Use of target plates allows a substantially larger amount of light to be reflected from the target to the tool.

Examples of situations where an insufficient amount of light is reflected include missed targets (e.g. a laser beam that misses the ceiling and is instead aimed at the sky), luminous, non-reflective surfaces, obstructions such as mist, rain or dust between the tool and the target, non-reflective dark surfaces or surfaces with a velvety structure, materials that absorb light, such as foam, or rough surfaces.

3.12.2.1 Rough surfaces

When measuring to rough surfaces, such as rough plaster, an average distance value is established with the center of the laser spot weighted higher than the edges of the laser spot.

3.12.2.2 Curved or inclined surfaces

If the laser beam strikes the target surface at a very narrow angle, the light reflected may be inadequate. Conversely, too much light may be reflected toward the tool in situations

where the laser beam strikes the target perpendicularly. We recommend use of a target plate (PDA 50, PDA 51 or PDA 52) in both of these situations.

3.12.2.3 Wet or shiny surfaces

A still, calm pond reflects both the clouds and light from the sky. A shiny, wet surface reflects the laser light in a similar way. If the targeted surface is wet and shiny, it is important that the measurement is taken at right angles, as far as possible, as otherwise the light will be reflected in a different direction and too little light will return to the tool to calculate a measurement.

Curved surfaces can also make it more difficult to reflect enough light in the direction of the tool for a measurement to be taken.

3.12.2.4 Transparent surfaces or surfaces that absorb light

It is generally possible to measure distances to transparent or semi-transparent materials, e.g. liquids, polystyrene foam, etc.. However, as light penetrates these materials, measuring errors may occur.

3.12.2.5 Disruption between the tool and the measuring target

Measuring errors can occur if, for example, measurements are taken through glass panes or other objects such as dust or aerosols are located between the laser source and the measuring target.

4 Introduction to the measuring application

4.1 Measuring application functions and assistants

4.1.1 Functions

Functions can be selected from the following function groups in the measuring application's '**Functions**' drop-down menu:

Function groups and functions

Function group	Functions
'Direct'	'Direct'
'Photo'	<ul style="list-style-type: none">'Draw in Picture''Measure from picture'
'Area and Volume'	<ul style="list-style-type: none">'Rectangle''Volume Room''Volume Cylinder'
'Indirect'	<ul style="list-style-type: none">'Indirect''Vertical''Overhead''Not reflecting''Min/Max/Delta'
'Pythagoras'	<ul style="list-style-type: none">'Pythagoras I''Pythagoras II''Pythagoras III'
'Trapezoid'	<ul style="list-style-type: none">'Trapezoid''Trapezoid I'
'System Settings'	Settings for the measuring application

4.1.2 Measuring with the help of the trigger, timer and aiming camera

Before taking a measurement, you can activate the following assistants to provide support for distance measurements using the  icon on the (→ page 13) toolbar:

- **Triggers** provide support by automatically taking a measurement when distance measurements have to be taken at an angle which is exactly horizontal or vertical, or when the longest or shortest distance within a continuous measurement sequence has to be determined.
- **Timers** provide the option of taking a measurement 3, 5, 10 or 15 seconds after the measure button is pressed.
- Measuring target tracking using the **aiming camera** provides support when aiming at measuring targets that are difficult to see.

Possible combinations of assistants and functions

Function	Assistant		
	Trigger	Timer	Aiming camera
‘Direct’	✓	✓	✓
‘Measure from picture’	✓	✓	✓
‘Draw in Picture’	✓	✓	✓
‘Area and Volume’	✓	✓	✓
‘Indirect’	✓	✓	✓
‘Not reflecting’	Yes, for the first measurement. Not for the second measurement (angle measurement only)	Yes, for the first measurement. Not for the second measurement (angle measurement only)	✓
‘Min/Max/Delta’	Not applicable	Not applicable	✓
‘Pythagoras’	✓	✓	✓
‘Trapezoid’	✓	✓	✓

4.1.3 Standard laser (single measurement)

In ‘Standard Laser’ mode, after a measure button is pressed and the measurement is taken, the laser is switched off.



The current mode – ‘Standard Laser’ or ‘Permanent Laser’ – is displayed as an icon on the status bar on the main screen.

4.1.4 Permanent laser (multiple measurement)

In ‘Permanent Laser’ mode, the laser is not switched off after a measure button is pressed and the measurement is taken, instead remaining on. This means that measurements can be carried out in quick succession without having to repeatedly switch the tool on.



The current mode – ‘Standard Laser’ or ‘Permanent Laser’ – is displayed as an icon on the status bar on the main screen.

4.1.5 Using the aiming camera

Aiming with the help of the camera facilitates accurate orientation of the laser range meter, even at longer distances.



Minimum spacing required for use of the aiming camera's cross hairs

The aiming camera makes it easier to accurately position the laser spot. This is useful both outside in daylight and in the case of larger interior distances, i.e. whenever it is difficult or impossible to distinguish the laser spot.

The aiming camera and the laser are located next to each other, two to three centimeters (roughly an inch) apart. As a result, when measuring short distances, the laser spot and the center of the cross hairs cannot be aligned. This behavior is normal and is caused by the same parallax error that allows you to see two fingers if you hold a single finger against the tip of your nose. The laser spot and the cross hairs can be aligned from two meters away (roughly 6.5 feet) when the zoom is switched off or from five meters away (roughly 16 feet) when the zoom is set to maximum.



Note

The measurement is always calculated from the laser spot, regardless of the center of the cross hairs.

Zoom and brightness

When the aiming camera is activated, the zoom and brightness can be adjusted by tapping and swiping.

Zoom

Tapping on the lower edge of the screen activates the zoom setting. A bar on the upper edge of the screen shows the current magnification as a percentage. Swiping left or right on the lower edge of the screen allows you to adjust the magnification.

Brightness

Tapping on the right edge of the screen activates the brightness setting. A bar on the right edge of the screen shows the current brightness as a percentage. Swiping up or down on the right edge of the screen allows you to adjust the brightness of the aiming camera picture.

4.1.6 Measuring references

Reference positions

	The reference position is the laser exit window, i.e. the front edge of the tool.
--	---

	The reference position is the tripod thread on the back of the tool.
	The reference position is the tripod thread on the base of the tool.

The laser range meter can measure distances from three different points of contact or measuring references. You can switch between the laser exit window, base of the tool and thread on the underside of the tool using the '**Measuring references**' menu on the toolbar. When screwing a measuring extension or a tripod to the base of the tool (position (9) on the product overview), the tool will query whether a short or long measuring extension is being used or whether a different value has to be entered. The tool automatically sets the appropriate measuring reference for the selected measuring extension. For other purposes, such as a value for a tripod, the result from a new measurement, a saved result or a numerical input can be used.

Offset settings

The '**Offset Value**' function automatically increases or reduces all measurements by a defined value. The offset value is set using the following options:

- '**New measurement
- '**Data
- '**Numeric Input******

4.2 Measuring with the help of triggers and timers

4.2.1 Activation and deactivation

The icon is used to activate the trigger and the timer, which provide assistance during the measuring process. The trigger and timer can be combined with various measuring functions (→ page 18).



The '**Default mode**' option can be used to deactivate the trigger and the timer.

4.2.2 Trigger 'Minimal'

The tool records the shortest distance registered during continuous measurement.

Note

This measuring program is particularly helpful if a measurement to a target position has to be taken completely plumb.

4.2.3 Measuring minimum distance

1. Press the "Measure" button once.
▫ Continuous measurement begins.
2. Press the "Measure" button again.
▫ Continuous measurement ends and the shortest distance determined during continuous measurement is displayed.

4.2.4 Trigger 'Maximal'

The tool records the greatest distance registered during continuous measurement.



Note

This measuring program is particularly helpful if a measurement has to be taken in a hard-to-reach area, such at the corner of a ceiling.

4.2.5 Measuring maximum distance

1. Press the "Measure" button once.
 - Continuous measurement begins.
2. Press the "Measure" button again.
 - Continuous measurement ends and the longest distance determined during continuous measurement is displayed.

4.2.6 Trigger 'Horizontal'

During continuous measurement, the tool only records values registered at an incline of 0°.



Note

This measuring program is particularly helpful if a measurement has to be taken exactly in the horizontal plane but you do not have a tripod to hand. It ensures that the tool does not deviate from the horizontal plane.

4.2.7 Measuring horizontal distances

1. Press the "Measure" button once.
 - Continuous measurement begins.
2. Aim the tool at approximately 0°.
 - At exactly 0° the tool takes a measurement automatically, ends continuous measurement and displays the horizontal distance.

4.2.8 Trigger'Vertical'

During continuous measurement, the tool only records values registered at an incline of 90°.



Note

This measuring program is particularly helpful if a measurement has to be taken at a completely vertical angle but you do not have a tripod to hand, by ensuring that the tool does not deviate from a vertical orientation.

4.2.9 Measuring vertical distance

1. Press the "Measure" button once.
 - Continuous measurement begins.
2. Aim the tool at approximately +90° or -90°.
 - At exactly +90° or -90° the tool takes a measurement automatically, ends continuous measurement and displays the vertical distance.

4.2.10 Delayed measurement using 'Timer'

When measuring using the 'Timer' function, the tool takes a delayed measurement after the measure button is pressed. This delay can be set to 3, 5, 10 or 15 seconds.



Note


The 'Timer' function cannot be combined with the assisted measuring methods.

4.3 Measurements, managing project folders and exporting data

4.3.1 Measurements

The tool saves measurements, photos of the measured targets and any calculations that have been carried out. Each result can be supplemented with annotations or a photo.

With average camera settings and ordinary use, approximately 3000 results can be saved. The tool will notify you if the memory capacity is full. Further results can only be saved once space has been created in the project folders. Each result is saved in a project folder. Results are shown in chronological order, with the most recent result at the top.

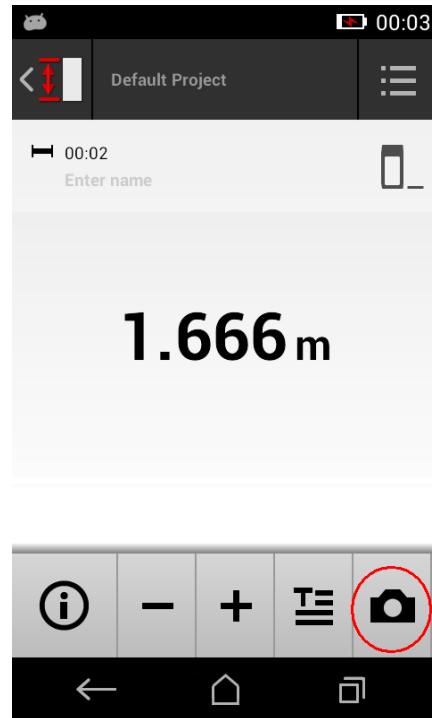

4.3.2 Displaying measurements

Regardless of the unit of measurement selected in the ‘Settings’ menu, the measuring application shows the calculated results as a numerical value to three decimal places.



Note

This value, shown to three decimal places, does not provide the real range in the case of either direct or indirect measurements. Rather, this value represents as accurate a calculation as possible. In the case of direct measurements, the result shown may deviate from the actual value by up to ± 1 mm.

Results produced by indirect calculations do not achieve the same level of accuracy as results from direct calculations.

4.3.3 Managing project folders

You can add and name projects. If no project folder has been set up, measurements are saved to a folder labeled ‘Default Project’.

If you delete the ‘Default Project’ folder, all of the results in this folder are deleted and the ‘Default Project’ folder is recreated.


Project folders can be renamed or deleted. The last folder used is displayed when the tool is switched back on.

Measurements cannot be moved to different project folders.

- You should therefore ensure that the correct folder for the project has been either selected or created before taking any measurements.

4.3.4 Buttons for managing project folders

- ▶ The buttons for editing and deleting project folders and exporting files can be accessed by swiping left on the project folder entry.
- ▶ Use the pencil icon to rename the project.
- ▶ Use the trash icon to delete the project along with all of its content.
- ▶ Use the export icon to export all of the results from the current project into a file.
- ▶ Use the export icon to export individual results from the current project that were created using the '**Measure from picture**' and '**Draw in picture**' functions.

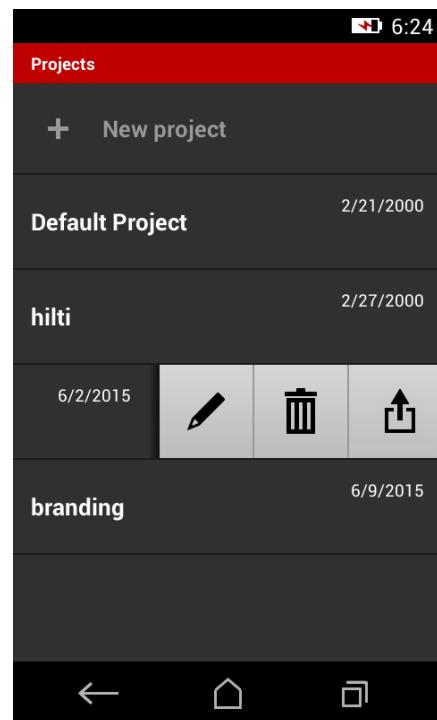

4.3.5 Exporting data

The PD-C and PD-CS can share files via Bluetooth or transfer files to a third-party application via WLAN. Third-party applications may be used at the discretion of the user and at his or her own responsibility. The terms of business or login configurations may change through use of third-party applications. **Hilti** accepts no responsibility and provides no support for third-party applications.



Note

Users of Mac computers with Mac OS X 10.5 and later versions, who wish to transfer files from the PD-C to a Mac computer, may download the official file transfer software from Android. Please visit <https://www.android.com/filetransfer/> for more information.

The target device for the Bluetooth connection must already be paired in order for the file transfer to take place.



Note

Many Bluetooth-enabled devices with Android or PCs with various versions of Windows were successfully paired during the course of our tests. Nevertheless, **Hilti** cannot guarantee that pairing will work with every device. Apple does not allow the range meter to transfer files to Apple devices via a Bluetooth connection.

Projects can be exported in PDF or CSV format, while results from the '**Measure from picture**' and '**Draw in Picture**' functions are exported as a JPG file. The files can also be exported to the flash memory on the range meter. They can then be transferred from the flash memory to a PC using a micro-USB cable.

4.3.6 Exported data in flash memory



Note

Results that are no longer required should be deleted on a regular basis in order to ensure that the PD-C and the PD-CS do not reach the limit of their 2 GB memory capacity.

However, even if the sizes of the result files vary, for example because they contain annotated pictures, typical users can store approximately 3000 results in the available memory.

Files in flash memory cannot be viewed using the PD-C or the PD-CS on their own. The current software provides no file management function that will allow the user to view, edit or delete files stored in the flash memory.

Once the PD-C is connected to a PC using a micro-USB cable, the root folder of the PD-C should appear in the Windows file system under "My Computer". The name of the folder is pdc_export. This folder contains subfolders for all of the exports, chronologically ordered by the date and time of the export as well as by the name of the project or result.

- ▶ Copy the folder or specific files in the pdc_export directory to your PC.

4.4 Point measurements and range (multiple) measurements

Distance measurements can be carried out as point or range (multiple) measurements.

Point measurements

In point measurements, the range is measured for the targeted point.

Range (multiple) measurements

In range (multiple) measurements, either a minimum or maximum figure is determined for the scanned area. A range (multiple) measurement is used to set out given distances or lengths and can also be used where distance measurement is otherwise difficult, e.g. at corners, edges or in niches, etc..

During a range (multiple) measurement, the range is displayed virtually in real time. The speed at which the display is updated depends on the reflectivity of the target surface.

After the measurement is completed, the results page is displayed in the project folder.

4.5 Measuring range

The brightness of ambient light has an effect on the measuring range.

4.5.1 Increase ranges

The range of the tool is generally increased when measurements are taken in the dark, at dawn or dusk and when the target and/or the tool is shaded from bright light.

Use of the PDA 72 measuring extension or a tripod increases the likelihood of successful measurement at long distances by making it easier for the tool to receive reflected beams. Use of target plates also allows you to increase the range of the tool (→ page 15).

4.5.2 Reduced ranges

Measuring range may be reduced if ambient light is very bright, e.g. in bright sunlight or when working under very powerful floodlights.

Measurements taken to mat green, blue or black surfaces may reduce the range of the tool to the same extent as wet or shiny surfaces.

The range may be reduced or the result distorted if objects are located in the path of the laser beam or if measurements are taken through glass.

4.6 Recording measuring targets with the help of the camera

1. Tap on the "Camera" icon.
2. Record the target using the camera and align the cross hairs over it.
3. Take the measurement.
4. Tap on the "Camera" icon again if you no longer wish to work with the camera's assistance.

5 Preparation and settings

5.1 Charging the built-in battery

- ▶ Charge the internal battery completely before using the tool for the first time (see → page 8).

5.2 Switching on and off, standby mode and unlocking

5.2.1 Switching on

1. Press the on/off switch briefly.
 - The product will be ready for use after 15–20 seconds. The locked display is shown.
2. To unlock the display, swipe the lock symbol off the screen to the right.
 - The measurements for the currently active project are displayed and ☰ can be used to select functions.

5.2.2 Standby mode or switching off

After normal use, the range meter can either be switched off or set to standby mode. The tool automatically switches to standby mode after a certain length of time without use. If the battery is fully charged and Bluetooth is deactivated, the tool can remain in standby mode for between one week and one month before it has to be recharged. This means that standby mode is ideal for normal daily use.

5.2.3 Activating standby mode

- ▶ Press the on/off switch briefly.
 - The display switches off and the tool goes into standby mode.



Note

If the range meter is in standby mode, it can be reactivated using any of the four buttons.

5.2.4 Unlocking the tool



Note

If the tool has not been used for some time, it switches to sleep mode and the display is locked.

1. Press one of the four buttons on the tool.
 - The display switches on and the lock symbol is shown.
2. To unlock the display, swipe the lock symbol off the screen to the right.
 - The tool is unlocked.



Note

Pressing one of the three measure buttons will take you directly to the 'Direct' function.

5.2.5 Switching off



Note

If you will not need the tool in the next few days or if you will have to go for a long time without charging the battery, all you have to do is switch the tool off.

1. Press the on/off switch for several seconds.
2. Select '**Switch off**' from the menu.
3. Confirm the settings by pressing '**OK**'.
 - The tool vibrates twice and switches itself off.

5.3 Adjusting the inclination sensor



Note

Regular adjustment of the inclination sensor helps ensure high measuring accuracy. This applies to indirect measurements in particular, the results of which rely on the accuracy of the inclination sensor.

(The inclination sensor does not influence the accuracy of the laser in direct measurements.)

1. Select the option '**Settings**' and '**Adjusting the inclination sensor**' from the '**Functions**' menu.
2. Lay the tool on a flat surface with the display facing upwards.
3. Press the "Measure" button.
4. Rotate the tool, without lifting it off the surface, until it points in the opposite direction.
5. Press the "Measure" button.
 - The inclination sensor is adjusted.

5.4 Establishing a Bluetooth connection



Note

If you are connecting the range meter to another device via Bluetooth for the first time, ensure that Bluetooth is activated on the other device and that the counterpart device is set to be visible to other devices. Without taking these two steps, it may not be possible to connect the range meter to the other device.

1. Open the tool settings on the start page.
2. Switch on the "Bluetooth" option in the "WIRELESS & NETWORKS" section.
3. Select "More...".
 - The tool searches for suitable Bluetooth devices.
4. In the settings on the device to which you want to connect the tool, ensure that the device is visible to other devices and that it is able to connect to new devices. Further information may be included in the documentation for the respective devices.
5. If no Bluetooth devices were found, select "Search for devices".
6. Select the device you wish to pair with under "Available devices" as soon as it is displayed.
7. Confirm the pairing by pressing "Yes" or "Pair".



Note

You can increase the battery life of the Li-ion battery if you deactivate Bluetooth after carrying out a data transfer.

5.5 Establishing a WLAN connection

PD-CS

1. Open the system settings.
2. Activate WLAN in the **Wireless and networks** section.
3. Select the desired network.

5.6 Settings for the measuring application

Setting	Description
'Length unit'	Selecting the unit of length for distance measurement For Japan: Tools registered in Japan are only able to work with metric units. Note After selecting a different unit, any saved measurements are converted into the new unit.
'Slope unit'	Selecting the unit of length for inclines
'Audible signal'	Switching the audible signal on or off
'Vibration'	Switching vibration on or off
'Adjusting the inclination sensor'	Starting the adjustment process
'Target picture'	Switching the creation of a target picture on or off. The target picture is saved and displayed together with the measurement in the results list. Standard setting: On
Standard setting for the aiming camera for direct measurement ('Target camera by default, for direct function')	Set the aiming camera to "On" or "Off" as the default setting for direct measurements (individual measurements). When set to "Off", the aiming camera can be switched on as needed. When set to "On", the aiming camera is always switched on automatically when preparing to take a direct measurement. Standard setting: Off
Standard setting for the aiming camera for combined functions ('Target camera by default, for combined functions')	Set the aiming camera to "On" or "Off" as the default setting for all measurements except direct measurements. When set to "Off", the aiming camera can be switched on as needed in order to make it easier to position the laser spot. When set to "On", the aiming camera is always switched on automatically when preparing to take a direct measurement. Standard setting: Off
'Default settings'	The "On" setting reactivates the standard settings for all measuring application settings.
'Default settings'	The "On" setting reactivates the standard settings for all measuring application settings.
'PD-C project export'	The Hilti logo that appears at top left of PDF reports can be set to "on" or "off". Standard setting: On

Setting	Description
'Please choose valid image type (jpg/png)'	The user's business card can be shown or hidden (on the PDF report). Before this function can be used, a photograph of the business card must be taken with the device. Standard setting: None

6 Working with the measuring application

6.1 Direct measurements using the 'Direct' function

6.1.1 Taking single, direct distance measurements

1. Select the project for which you wish to take the measurement.
2. Select the '**Direct**' option from the '**Functions**' menu.
 - The laser is switched on and a measure button icon appears on the display.
3. Position the base of the tool on the starting point of the measurement. When doing so, ensure that the tool is in a stable position.
4. Maintaining the stable position of the tool, aim the laser spot at the end point of the measurement.
5. Tap on the measure button icon or press a measure button.
 - The measurement ends and the result is displayed.
 - You can access additional information about the result by tapping on the information icon.



Note

You can add a picture for annotation purposes by tapping on the camera icon, or you can swipe the results list to the left to inspect the target picture for the measurement.

6.1.2 Continuous measuring (tracking) mode

This mode is activated by holding down the measure button for a longer time, and is particularly useful when using the '**Horizontal**', '**Vertical**', '**Maximal**' or '**Minimal**' triggers.

6.1.3 Activating continuous measuring (tracking) mode

1. To activate the continuous measuring (tracking) mode, hold down one of the measure buttons for roughly two seconds.
 - Once continuous measuring (tracking) is activated, the audible signal will sound 2–3 times per second and the distance will be shown in the middle of the display on a continuous basis.
2. To deactivate continuous measuring (tracking), tap the distance shown in the middle of the display or press one of the measure buttons.
 - The audible signal stops and the last valid measurement is displayed.



Note

You can switch off the audible signal in the settings for the measuring application.

6.2 Determining and recording distances in pictures using the 'Picture' function

There are two functions that allow distances to be determined and recorded directly in a picture taken using the built-in camera.

- Determine distances in pictures ('**Measure from picture**')

- Draw in pictures (**‘Draw in picture’**)

The built-in front camera is optimized to detect the laser spot at greater ranges and therefore features a narrow field of view. To obtain pictures of wider areas, the distance from the object to be surveyed must be increased accordingly.

The built-in image-recording camera (PD-CS) has a wide field of view. This camera is activated only when the **Draw in Picture** function is in use.

6.2.1 ‘Measure from picture’

This function provides approximate values for distances you plot with lines along certain elements in the picture. These lines must be drawn on a level surface (2D), such as on a wall, facade or ceiling.

Examples of applications for the ‘Measure from picture’ function:

- Estimation of an approximate distance, e.g. the minimum height of a ladder in relation to the height of a wall so that the top of the wall will remain within reach
- Estimation of the space available for the installation of a fascia on a facade

If the laser beam is aligned at right angles (90°) to the level surface, the estimation is accurate to ±1–2%.

The limitation of this function compared to the next function, ‘**Draw in picture**’, is that when taking measurements and surveying, the right angle has to be maintained exactly. The tool is unable to ascertain whether the camera angle is correct or whether the surface in the picture is level. In this case, the deviation between the estimation and the actual measurement would be significant.

While you are drawing and extending a line, you can view the distance on the display that is automatically calculated from the picture.

6.2.1.1 Determining distances in pictures

1. Select the option ‘**Picture**’ and ‘**Measure from picture**’ from the ‘**Functions**’ menu.
 - The laser is switched on.
2. Hold the tool at right angles to the level surface you are aiming at.
3. Press the measure button once or tap on the cross hairs.
 - The targeted area is surveyed and the measured distance is displayed.
4. Tap on the pencil icon.
 - The line icon and the icon for annotations appear and fade back out after a few seconds.



Note

If the icons have faded out, tap the picture to display the icons again.

5. Tap the line icon.
 - A line is placed in the picture.
6. Move the starting and end points of the section into the approximate positions.



Note

The starting and end points of the section must lie within the level surface. If the picture contains areas that are not part of the level surface, positioning the end points in these areas will lead to values that deviate significantly.

7. Touch and hold the end point to enlarge it, and then release the end point in exactly the right position.
 - The determined length of the line positioned in the picture is displayed.



6.2.1.2 ‘Measure from picture’ – additional functions

- ▶ Add line segments: Select the “New line segment” icon at lower left.
- ▶ Extend or remove line segments: Tap the line segments on the display.
- ▶ Draw an area: Where you have three or more line segments, connect the last segment to the first one.

6.2.2 Recording measured distances in pictures (‘Draw in picture’)

1. Select the option ‘Picture’ and ‘Draw in picture’ from the ‘Functions’ menu.
2. Enter the area in which you would like to record measured distances.



Note

You may also select a picture from the gallery instead of a photo.

3. Tap the check mark if you would like to use the picture.
 - The picture will be adopted and displayed for editing.



Note

You can repeat the following steps at any time if you reopen the picture in the project folder.

4. Tap the pencil icon.
 - The line icon and the icon for annotations appear and then fade out after a few seconds.



Note

If the icons have faded out, tap the picture to display the icons again.

5. Tap the line icon.
6. Select the source of the distance input: either by taking a measurement with ‘Direct’, by selecting a saved measurement with ‘Data’ or by entering a value with ‘Numeric Input’.
 - A dimensioned line will be placed in the picture.
7. Move the starting and end points of the line segment into the approximate positions.
8. Touch and hold the end point to enlarge it and then release the end point in exactly the right position.
 - You can now view or edit the picture.
9. To save the picture, export it as a JPG file.



6.2.2.1 Documenting the distances measured on pictures – additional functions

- ▶ Edit the stored result: Tap on the pencil icon at the lower left.
- ▶ Add a description in text form: Tap on the text icon at the lower middle.
- ▶ Export the result as a JPG file: Tap on the icon at the lower right.

- ▶ Insert a section in the photo: Tap on the icon at the lower left.
- ▶ Insert a text box in the photo: Tap on the icon at the lower right.

6.3 Calculating areas and volumes

6.3.1 Functions‘Area and Volume’

Areas of rectangles and triangles as well as volumes of cuboids and cylinders can be calculated directly using the icons on the touchscreen.

6.3.2 Calculating rectangular areas

1. Select the option ‘Area and Volume’ and ‘Rectangle’ from the ‘Functions’ menu.
2. Measure the width.
3. Measure the height.
 - The area is displayed.

6.3.3 Calculating rectangular areas – additional functions

1. Select the symbol for the "Sum" function after generating a result.
2. Continue measuring areas.
 - The total area is displayed.
3. Read the result.

6.3.4 Calculating cubic volumes

1. Select the option ‘Area and Volume’ and ‘Volume Room’ from the ‘Functions’ menu.
2. Measure the length.
3. Measure the width.
4. Measure the height.
 - The volume is displayed.

6.3.5 Calculating cylindrical volumes

1. Select the option ‘Area and Volume’ and ‘Volume Cylinder’ from the ‘Functions’ menu.
2. Measure the length.
3. Measure the diameter.
 - The volume is displayed.

6.4 Indirect measurements

6.4.1 Using indirect measurements



Note

The accuracy of measurements taken using the ‘Indirect’ and ‘Pythagoras’ functions is primarily dependent on whether the reference position is kept constant. This is not easy to achieve if the tool is simply held by hand, without any form of support. Greater accuracy can be achieved if the tool is set down on a firm surface, such as a table or floor. If no firm surface is available, it can help to attach the tool to the center of your own body, for example by securing it to a belt.

The best solution is always to rest the measuring extension on a flat, firm surface. The most effective way to improve accuracy is to maintain the point of the measuring extension at exactly the same reference position while the measurements are taken.

Indirect measurements can be used to determine distances that cannot be measured directly. There are several methods that can be used to indirectly measure distances. A

visual representation shows you which distance to measure for each partial measurement. Once all of the necessary distances and inclines have been measured, the result is calculated and shown on the display.

In principle, results obtained from indirect measurements cannot be expected to have the same accuracy as results obtained from direct measurements.

6.4.1.1 Guidelines for indirect measurements

- ▶ Observe the guidelines below in order to obtain the best possible results.
- ▶ Pay attention to the geometry (i.e. right angles and triangle relationships).
- ▶ Carefully aim the tool at the corners of the object when all of the measuring points lie in the same plane and you are taking measurements from a location not too far away from the object.
- ▶ Do not tilt the tool to the side when measuring at an angle as this will cause measuring errors. If the tool is tilted to the side, a warning message will be displayed and it will not be possible to take measurements.
- ▶ When taking indirect measurements, ensure that all measurements are taken in either a vertical or horizontal plane.
- ▶ Use exactly the same point of contact and pivot axis in all measurements for the ‘**Indirect**’ and ‘**Pythagoras**’ functions.

6.4.1.2 ‘Indirect’ versus ‘Pythagoras’

At first glance, there is little to distinguish the two functions. The main difference is that the ‘**Indirect**’ function group relies on the tool’s vertical inclination sensor, and each measurement has to be taken in the same vertical plane. In contrast, the ‘**Pythagoras**’ function group does not use the inclination sensor, therefore allowing measurements to be taken in a direction regardless of the incline.

The ‘**Indirect**’ function group can be used, for example, to calculate the height of a wall by measuring just two points: To the bottom, where the floor and wall meet, and to the point exactly above this where the wall and ceiling meet.

The tool is able to indirectly calculate the height because it knows the angle of both measurements.

The same result can be obtained using the Pythagoras functions. As the inclination sensor is not active, at least one plumb measurement must be taken to the analyzed object.

The advantage of taking measurements using the ‘**Indirect**’ function group is that fewer steps are required. The advantage of taking measurements using the ‘**Pythagoras**’ function group is that horizontal and diagonal lengths can be measured indirectly, provided that at least one plumb measurement can be taken to the section.

6.4.2 ‘Indirect’, ‘Vertical’

This function measures the vertical distance between two points on a completely vertical structure.

It is particularly suitable for when a vertical distance on a wall has to be measured without direct access (e.g. determining the story height on a building).

6.4.3 Measuring horizontal distances indirectly

1. Select the option ‘**Indirect**’ and ‘**Horizontal**’ from the ‘**Functions**’ menu.

2. Measure the distance to the vertical axis of the 90° structure at any desired angle, but within the same vertical plane in which the distance to be measured lies.
 - The result is displayed.



Note

Adjust the inclination sensor at regular intervals (→ page 26). This helps ensure high measuring accuracy.

6.4.4 Measuring vertical distances indirectly

1. Select the option ‘**Indirect**’ and ‘**Vertical**’ from the ‘**Functions**’ menu.
2. Position the tool so that the display is facing upwards or downwards. It is essential to avoid inclination to the side.



Note

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

This indirect function makes use of the angle sensor, which works only with a vertical pivot. In other words, the display can face upwards or downwards, but should not be tilted to the left or right. If it is tilted to the side by more than 5° then the inclination indication disappears from the display and angle measurement is no longer possible.

3. Measure the distance to the upper end point.
4. Keeping the reference position the same, tilt the tool in the vertical plane towards the lower end point.
5. Measure the distance to the lower end point.

- The result is displayed.



Note

Adjust the inclination sensor at regular intervals (→ page 26). This helps ensure high measuring accuracy .

6.4.5 Measuring horizontal distance overhead indirectly

1. Select the option ‘**Indirect**’ and ‘**Overhead**’ from the ‘**Functions**’ menu.
2. Position the tool so that the display is facing upwards or downwards. It is essential to avoid tipping the tool to the side.



Note

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

This indirect function makes use of the angle sensor, which works only with a vertical pivot. In other words, the display can face upwards or downwards, but should not be tilted to the left or right. If it is tilted to the side by more than 5° then the inclination indication disappears from the display and angle measurement is no longer possible.

3. Measure the distance to the first end point.
4. Keeping the reference position the same, tilt the tool in the vertical plane towards the second end point.

- Measure the distance.
 - The result is displayed.



Note

Adjust the inclination sensor at regular intervals (→ page 26). This helps ensure high measuring accuracy .

6.4.6 ‘Indirect’, ‘Not reflecting’

This function measures the distance to the end point of an object that is barely reflective, such as the top of a crane or a tree.

It is suitable for calculating a distance if a target point is not reflective.

6.4.7 Measure the height of an object when only one target point is clearly visible – indirect measurement

- Position the tool so that the display is facing upwards or downwards. It is essential to avoid tipping the tool to the side.



Note

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

This indirect function makes use of the angle sensor, which works only with a vertical pivot. In other words, the display can face upwards or downwards, but should not be tilted to the left or right. If it is tilted to the side by more than 5° then the inclination indication disappears from the display and angle measurement is no longer possible.

- Measure the distance to the lower end point.
- Keeping the reference position unchanged, pivot the tool vertically towards the upper end point. Switch the aiming camera on if the end point you are targeting is not reflective.
- Take the measurement to the end point.
 - The tool measures the angle to the end point and the result is displayed.



Note

Adjust the inclination sensor at regular intervals (→ page 26). This helps ensure high measuring accuracy .

6.4.8 Minimum and maximum and the difference between them within a range

6.4.8.1 Min/Max/Delta

This function activates continuous measurement. By sliding the tool along a level reference surface during a measurement, for example, or rotating it around a point of reference, you can determine the maximum and minimum distance from the reference object, as well as the difference between the minimum and maximum values.

6.4.8.2 Determining the difference between the minimum and maximum distances within an area

- Activate the ‘Min/Max/Delta’ function.
- Position the tool.
- Press a measure button.
 - Continuous measurement begins.
- Move the tool along the reference line or reference plane.

5. Press a "Measure" button again.
 - The measurement ends and the result is displayed.

6.5 Measurements using Pythagoras functions

6.5.1 Function group 'Pythagoras'

Note

You will obtain the most accurate results for the '**Indirect**' and '**Pythagoras**' functions if you use exactly the same point of contact and pivot axis for every measurement.

Note

Pythagoras functions are particularly helpful for measuring horizontal and vertical lengths indirectly as these cannot be measured using the functions of the '**Indirect**' group.

6.5.2 Function 'Pythagoras I'

This function indirectly determines the length of a section by taking a 90° measurement to the starting point of the section. This is useful for determining the lengths of horizontal sections.

6.5.3 Measuring using the 'Pythagoras I' function

1. Measure the distance to the closer section end point from a position at right angles.

Note

When taking the measurement at right angles it is important to adhere exactly to the 90° angle.

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

As the Pythagoras functions do not make use of the inclination sensor, the tool can be pivoted in any direction.

2. Measure the distance to the farthest end point of the section.
 - The result is displayed.

6.5.4 Function 'Pythagoras II'

This function indirectly determines the length of a section by taking a 90° measurement to a point within the section.

6.5.5 Measuring using the 'Pythagoras II' function

1. Measure the distance to the first end point of the section.

Note

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

As the Pythagoras functions do not make use of the inclination sensor, the tool can be pivoted in any direction.

2. Measure a distance to the section from a position at right angles. Please note that this point must lie on the same line as the two section end points.



Note

When taking the measurement at right angles it is important to adhere exactly to the 90° angle.

3. Measure the distance to the other end point of the section.
 - The result is displayed.

6.5.6 Function‘Pythagoras III’

This function indirectly determines the length of a section by taking a 90° measurement to a point along a line extending past the section.

6.5.7 Measuring using the ‘Pythagoras III’ function

1. From a position at right angles, measure the distance to a point that lies on a line extending past the section.



Note

When taking the measurement at right angles it is important to adhere exactly to the 90° angle.

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

As the Pythagoras functions do not make use of the inclination sensor, the tool can be pivoted in any direction.

2. Measure the distance to the first end point of the section.
3. Measure the distance to the other end point of the section.
 - The result is displayed.

6.6 Measurements using trapezoid functions

6.6.1 Function group ‘Trapezoid’

To measure an inclined surface, three reference measurements must be taken.



Note

Measurements using the ‘Indirect’, ‘Pythagoras’ and ‘Trapezoid’ functions typically obtain considerably less accurate results than direct measurements. This is due to the variation in positioning that usually occurs when holding the tool by hand (without a stable tripod and without accurately marked contact points and target points).

6.6.2 Function‘Trapezoid I’

This function determines the length of an inclined surface using three reference measurements.

6.6.3 Measuring using the ‘Trapezoid I’ function

1. Measure from a starting point on a level surface to a target at the upper end of the sloping surface.



Note

The first and the third measurements must intersect with the section measured by the second measurement at an angle of 90°. Measuring accuracy can be increased by using the horizontal and vertical measure command buttons.

2. Measure the horizontal distance between the exact reference points used for the first and third measurements.
3. Measure from a starting point on the same level surface used for the first measurement to a target at the lower end of the sloping surface.
 - The result is displayed.

6.6.4 Function ‘Trapezoid II’

This function determines the length of an inclined surface using two reference measurements.

6.6.5 Measuring using the ‘Trapezoid II’ function

1. Measure from a starting point on a level surface to a target at the upper end of the sloping surface.



Note

Take care to ensure that the reference position remains unchanged during the entire measuring operation. Use of the short measuring extension is helpful.

2. Tilt the tool vertically downwards and aim at the lower end point.
3. Take a measurement to the lower end of the sloping surface.
 - The result is displayed.

7 Care and maintenance

7.1 Cleaning

Your tool is designed for typical operating conditions on construction sites. Its ingress protection against dust and splashes complies with protection class IP54.

Dirt on the glass guard on the camera lens and the laser exit window can impair measuring reliability and the clarity of measuring target imaging.

- ▶ If the tool is dirty, clean it with a soft, slightly damp cloth.
- ▶ Pay particular attention to the cleanliness of the glass guard on the camera lens and the laser exit window.
- ▶ To clean the glass guard on the camera lens and the laser exit window, switch the tool off and gently and carefully clean the glass surface right into the corners.

7.2 Touchscreen

The tool is equipped with a resistant touchscreen designed for regular operation with work gloves. The touchscreen is not designed for use with additional protective accessories. While such accessories can be used, they have not been tested and may impair the responsiveness of the touchscreen.

- ▶ Wipe the touchscreen with a clean, non-abrasive cloth so that it is shiny and responsive to the touch.
- ▶ Stop using the tool if the touchscreen is broken and contact **Hilti** Service.

7.3 Adjusting the inclination sensor

7.3.1 Adjustment intervals

In order to achieve greatest possible accuracy when making inclination measurements, the inclination sensor must be adjusted at regular intervals. Adjustment is also necessary if the product has suffered an impact or has been subjected to considerable temperature change.

7.3.2 Adjusting the inclination sensor

1. Select the option ‘Settings’ and ‘Adjusting the inclination sensor’ from the ‘Functions’ menu.
2. Lay the tool on a flat surface with the display facing upwards.
3. Press the “Measure” button.
4. Rotate the tool, without lifting it off the surface, until it points in the opposite direction.
5. Press the “Measure” button.
 - The inclination sensor is adjusted.

8 Transport and storage

8.1 Transport

- To protect the PD-C / PD-CS always use the soft pouch supplied by **Hilti** for carrying and for transport.

8.2 Storage

- Do not put the tool into storage when wet. Allow it to dry before putting it away.
- Observe the storage temperature limits for the equipment, which are given in the Technical Data section.
- Check the accuracy of the equipment before it is used after a long period of storage or transportation.

9 Troubleshooting

If the trouble you are experiencing is not listed in this table or you are unable to remedy the problem by yourself, please contact **Hilti Service**.

Trouble or fault	Possible cause	Action to be taken
The tool will not start.	The battery is discharged.	► Charge the built-in battery.
	The battery is faulty.	► Contact Hilti Service .

10 RoHS (Restriction of Hazardous Substances)

Click on the link to go to the table of hazardous substances: qr.hilti.com/r4890614. There is a link to the RoHS table, in the form of a QR code, at the end of this document.

11 Disposal

 Most of the materials from which **Hilti** tools and appliances are manufactured can be recycled. The materials must be correctly separated before they can be recycled. In many countries, your old tools, machines or appliances can be returned to **Hilti** for recycling. Ask **Hilti Service** or your Hilti representative for further information.



- Disposal of electric tools or appliances together with household waste is not permissible.

12 Manufacturer's warranty

- Please contact your local **Hilti** representative if you have questions about the warranty conditions.

13 FCC statement (applicable in US) / IC statement (applicable in Canada)

Note

This equipment has been tested and found to comply with the limits for a class B digital device, pursuant to part 15 of the FCC rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause interference to radio communications.

However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by taking the following measures:

- Re-orient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment to a power outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced TV/radio technician for assistance.

Note

Changes or modifications not expressly approved by **Hilti** may restrict the user's authorization to operate the equipment.

This device is in compliance with paragraph 15 of the FCC Regulations RSS-210 of the ISED Regulations.

Operation is subject to the following two conditions:

- This device shall cause no harmful interference.
- This device must accept any interference received, including interference that may cause undesired operation.

A

Adjusting the inclination sensor	26, 38
Aiming camera	13, 19
Brightness	19
Zoom	19

Apps

Switching over	13
--------------------------	----

Area

Rectangle	31
---------------------	----

Assistant

Aiming camera	18
Horizontal trigger	18
Maximum trigger	18
Minimum trigger	18
Offset	20
Timer	18
Vertical trigger	18

B

Battery, integrated	8
Brightness	19

C

Camera assistance	25
Continuous measurement	18
Continuous measuring (tracking)	28
Cross hairs	19
Guard with laser spot	19

D**Distance**

Difference between the minimum and maximum measurement	34
Horizontal	32

Distance measurement

Single	28
------------------	----

E**Exporting data**

To the flash memory	23
Via Bluetooth	23

F

Flash memory	24
Folding spike	14

G

Given distance	13
--------------------------	----

H

Home	1213
----------------	------

I

Inclination sensor	13
------------------------------	----

L**Laser**

Permanent	13, 19
Standard	13, 18

Laser spot	11, 19
-----------------------------	---------------

Guard with cross hairs	19
----------------------------------	----

M**Measurement**

Ending	13
Indirect	31
Multiple	19
Single	18
Triggering	13

Measurements	22
-------------------------------	-----------

Display	22
-------------------	----

Memory capacity	22
---------------------------	----

Measuring accuracy	15, 31
------------------------------	--------

Measuring application	12
---------------------------------	----

Measuring errors	16
----------------------------	----

Measuring extension

Long	14
Short	14

Measuring range	24
---------------------------	----

Measuring references	19
--------------------------------	----

'Min/Max/Delta'	34
----------------------------------	-----------

Multiple measurement	19
--------------------------------	----

N

Navigation bar	13
--------------------------	----

O

Offset	20
------------------	----

P

PDA 72	14
------------------	----

Permanent laser	19
---------------------------	----

Project folders

Buttons	23
-------------------	----

Managing	22
--------------------	----

R

Range	24
-----------------	----

Range (multiple) measurements	13
---	----

Reference position	13
------------------------------	----

Reference settings

Offset	20
------------------	----

S**Settings**

Measuring references	19
--------------------------------	----

Single measurement	18
------------------------------	----

Standard laser	18
--------------------------	----

Start page	1213
----------------------	------

Surface influences	16
------------------------------	----

T

Target plates	15, 24
-------------------------	--------

Target tracking	19
---------------------------	----

Tool lock	25
---------------------	----

Toolbar	1213
-------------------	------

Trigger	12
--------------------------	-----------

Deactivating (standard mode)	18
--	----

'Horizontal'	21
-------------------------------	-----------

'Maximal'	20
----------------------------	-----------

'Minimal'	20
----------------------------	-----------

'Vertical'	21
-----------------------------	-----------

U

Unlocking 25

V**Volume**

Cylinders 31

Z

Zoom 19

1. נטוונים על התיעוד

1.1 על אוזות תיעוד זה

- קרא את תיעוד זה במלואו לפני השימוש הראשוני. רק כך ניתן להבטיח עבודה בטוחה ונטולת תקלות.
- ציית להוראות הבטיחות והاذירות שבתיעוד זה ולאלה המצוינות על המוצר.
- שמור את הוראות הפעלה תמיד בצדם למוצר, והקפד להעביר אותן לאדם שאליו אתה מעביר את המוצר.

1.2 הסבר הסימנים

1.2.1 אזהרות

האזהרות מזהירות מפני סכנות בשימוש במוצר. במדריך זה מופיעות מילוט המפתח הבאות בשילוב עם סמלים:

סכנה! מצינית סכנה מיידית, המובילת לפצעות גוף קשות או למוות.	
אזהרה! מצינית סכנה אפשרית שיכולה להוביל לפצעות גוף קשות או למוות.	
זהירות! מצינית מצב שעלול להיות מסוכן ולהוביל לפצעות או לנזקים לרכוש.	

1.2.2 סמלים בסמוך זה

הסמלים הבאים מופיעים בתיעוד זה:

	קרא את הוראות הפעלה לפני השימוש
	הנחיות לשימוש ומידע שימושי נוספת

1.2.3 סמלים באירורים

הסמלים הבאים משמשים באירורים:

2	מספרים אלה מפנים לאיזור המתאים בתחילת חוברת ההוראות.
3	המספרים באירורים משקפים את רצף הפעולות, והם עשויים להיות שונים מרצף הפעולות המצוינות בטקסט.
11	מספר הפריטים מופיעים באירור סקירה ותואימים את המספרים בפרק סקירת המוצר .
!	סימון זה נועד לעורר את תשומת לך' המינוחית בעת השימוש במוצר.

1.3 מידע הנוגע ללייזר המצוין על המוצר

מידע על הליזר

קרנת לייזר. אין להבט אל הקREN. דירוג לייזר 2.	
---	--

1.4 הצהרת תאימות

אנו מצהירים באחריותנו הבלעדית כי המוצר המתואר כאן תואם את התקנות והתקנים התקפיים. בסוף תיעוד זה ישבו צילום של הצהרת התאימות.

התיעוד הטכני שמור כאן:

Hilti Entwicklungsgesellschaft mbH | Zulassung Geräte | Hiltistraße 6 | 86916 Kaufering,
Germany

1.5 פרטי המוצר

המוצרים של **Hilti** מיועדים למשתמש המקורי, ורק אנשים מומשכים, שעברו הכשרה מתאימה, רשאים לתפעל, לתחזק ולתקן אותם. אנשים אלה חייבים ללמידה באופן מיזח את הסכנות האפשריות. המוצר והउדרים שלו עלולים להיות מסוכנים כאשר אנשים שלא עברו הכשרה מתאימה משתמשים בהם באופן לא מקצועי או בעקבות שימוש שלא בהתאם לייעוד.

- רשום את המספר הסידורי בטבלה הבאה. בכל פניה לנציגינו או למעבדת שירות יש לציין את נתוני המוצר.

נתוני המוצר

PD-C PD-CS	דגם:
01	دور:
	מספר סידורי:

2 בתיוחות

2.1 הערות בתיוחות בסיסיות

זהירות



סכנה אפשרית להתחشمויות או לכויה! ניסיון להוציא את הסוללה עלול לגרום להתחشمויות, לנזק, לכויה ולולדיפת חומרים מסוכנים.

- אל תנסה לפתח את המוצר. לצורך החלפת סוללה פנה אך ורק למעבדת שירות של **Hilti**.

זהירות



סכנה אפשרית להתחشمויות או לכויה! נזלים, כגון גשם, טל וכדומה החודרים למכתירים מהווים סכנה חשמלית, שכן הם עשויים לגרום לנזק, לכויה ולפיצוץ.

- שמור את המכשיר תמיד במקום נקי ויבש.
- שמור על המכסה סגור, כדי שלא יוכל לחדר לתוכו המכשיר.

זהירות



סכנה אפשרית מהשלכות הקצר, עומס יתר ושרפה! סכנה אפשרית מקרינה תרמית, פליטת חלקים מותכים או תהליכיים כימיים עקב קוצר או עומס יתר או עקב שרפה שנגרמה בעקבותם.

- אין לחמס את המוצר ואין לחשוף אותו לאש. הסוללה שבמכשיר עשויה להתפוצץ, או שחומרים רעילים עלולים להשתחרר.
- השתמש רק בתקע-h-USB המאושר עם כבל מיקרו USB סטנדרטי.
- שימוש שגוי עלול לגרום לדליפת נזלים מהסוללה. אל תיגע בנזלים אלה. אם נוצר מגע, שטוף במים. אם הנוזל נוגע בעיניים, פנה לרופא. נוזל סוללות שדיף עלול לגרום לגירויים בעור ולכוויות.

אזהרה



סכנה עקב קרינה אלקטرومגנטית בתדרים גבוהים או נמוכים! קרינה אלקטرومגנטית יכולה לגרום למכשיר להתחל לפעול עצמאית. הקרינה המשודרת עשויה להפריע למיכרים אחרים.

- ◀ אין להשתמש במכשיר בקרבת אנשים שיש להם קוצב לב.
- ◀ אין להשתמש במכשיר בקרבת מכשירים רפואיים.
- ◀ אין להשתמש במכשיר בקרבת מתקנים צבאיים, שדות תעופה, במטוסים וכן במכשירים רדיואיסטרונומיים ללא אישור מראש.

זהירות



סכנה עקב קרינה וקרינת לייזר גלויה ולא גלויה! פגעה בעין כאשר מביטים לקרן הליזר!

- ◀ אבטח את מקום המדידה. הקפד בעת הצבת המוצר לא לכוון את הקרן לאנשים אחרים או לעצמך.
- ◀ אין להבטיח שירות למקור האור. אם נוצר מגע ישיר בעין, עצום את העיניים והוציא את הראש אל מחוץ לטווח הקרן.
- ◀ הרחק ילדים ממיכשיiri לייזר.

זהירות



סכנה עקב הפעלה לא מכונת של הליזר! קרן הליזר עשויה להתחל לפעול עקב לחיצה בשוגג על לחץ המדידה או עקב שגיאת תוכנה.

- ◀ מנע הפעלה בשוגג של קרן הליזר.
- ◀ בעת התנהלות עם המוצר היה מודע לכך שקרן הליזר עשויה להתחל לפעול בשוגג. לפניהם אתה מביט לתוך מסלול הליזר, ודא שקרן הליזר כבוייה, או כבה לגמר את המוצר.

אזהרה



סכנות פיצוץ! סכנה בעבודה באזוריים שיש בהם נזלים, גזים ואבקים דליקים.

- ◀ שים לב לתנאי הסביבה! אין להשתמש במוצר במקומות שקיים בהם סכנות שריפה או פיצוץ.

אפשרויות לשגיאות במדידה יתכנו מדידות שגויות כאשר חלה חריגה מטמפרטורת העבודה, כאשר ריכוד החלקיקים באוויר גבוה, כאשר הרכיבים האופטיים מלוכלכים, במידידה על מسطחים לא מתאים וכן בעקבות שגיאות שימוש.

- ◀ בכל הפעלה של המכשיר ובמהלך העבודה שים לב למידע ולאזהרות המופיעים על מסך המגע.
- ◀ לפני תחילת המדידה בדוק את רמת הדיק של המוצר.
- ◀ כאשר מעבירים את המוצר מאדור קר מאוד לסביבה חמה או להפוך יש לאפשר לו להתאקלם בסביבה החדש לפניו השימוש.

בדקים אפשריים עקב הגדרות שגויות. הגדרות שגויות, לדוגמה בעקבות שימוש במאירן מדידה באורך לא מתאים, עשויות להוביל לתוצאות שגויות ולנקדים תוצאותתיים.

- ◀ שים לב תמיד למידע ולאזהרות שעיל מסך המגע.
- ◀ ודא שאתה מבצע את המדידות בעדרת ההגדרות הנכונות.

בנוסף להערות הבטיחות הטכניות בפרקיהם השונים הפעלה אלה יש להקפיד באופן מיוחד על ההנחיות הבאות בכל עת. המוצר והउדרים שלו עלולים להיות מסוכנים כאשר אנשים שלא עברו הכשרה מתאימה משתמשים בהם באופן לא מקובל או בעקבות שימוש שלא בהתאם ליעוד.

- ◀ שמור את כל הוראות הבטיחות וההנחיות לעיון בעתיד.

- ◀ היה ערני, שים לב למה שאתה עושה, ופועל בתבונה כאשר אתה עובד עם המוצר. אל תשתמש במוצר כשאתה עיף או תחת השפעת סמים, אלכוהול או תרופות. די ברגע אחד של חוסר תשומת לך בדמן השימוש במוצר כדי לגרום פציעות קשות.
- ◀ אל תשיבת התקני בטיחות ואל מסיר הוזעות או שלטי אזהרה.
- ◀ הרגעה לא תקינה של המוצר עלולה לגרום לפלייטת קרינט ליזר החורגת מדרוג 2. **הבא את המכשיר לתיקון בעבודות שירות של Hilti בלבד.**
- ◀ התערבות או ביצוע שימושים בסוגים במוצר אסורים.
- ◀ לפני כל הפעלה של המוצר יש לוודא שהוא תקין.
- ◀ מדידות על משטחים בעלי החזקה גבוהה, בסביבה בעלת החזקה גבוהה עשויות להוביל לתוצאות מדידה שגויות.
- ◀ מדידה דרך זכוכיות או עצמים אחרים עלולה לגרום לתוצאה שגوية.
- ◀ כאשר תנאי המדידה משתנים במרירות, לדוגמה עקב אנשים העוברים דרך קרן הליזר, תוצאות המדידה עלולות להיות שגויות.
- ◀ אין לכונן את המוצר לשימוש או למקרוות או רוח חזק אחרים.
- ◀ המוצר המתואר והעדורים שלו עלולים להיות מסוכנים כאשר אנשים שלא עברו הכשרה מתאימה משתמשים בהם באופן לא מתאים או כאשר משתמשים בהם בהתאם ליעוד.
- ◀ כדי למנוע פצעות יש להשתמש אך ורק באביזרים מקוריים ובמכשירים מקוריים של **Hilti**.
- ◀ צית להנחיות להפעלה, טיפול ותחזקה המצוינות בהוראות ההפעלה.
- ◀ לעולם אין להשתמש במוצר ללא הדרכה מתאימה או לפני קריית תיעוד זה.
- ◀ תנאי סביבה מסוימים עשויים לשמש את תוצאות המדידה. תנאים אלה כוללים לדוגמה קרובם למיכרים היוצרים שדות מגנטיים או אלקטرومגנטיים חזקים, מדידה על משטחים לא מתאימים, שימוש במחדירים אוור לא מתאימים.
- ◀ מדידה על פלסטיקים מוקצפים כגון פוליסטרין, על שלג או משטחים בעלי החזקה נמוכה עשויה לגרום לערכי מדידה שגויים.

2.2 הכנה בכונה של מקום העבודה

- ◀ כאשר אתה עובד על סולם הימנע מעמידה בתנוחה לא רגילה. עמוד באופן יציב ושמור תמיד על שיווי משקל.
- ◀ אבטח את אזור המדידה, וודא כי איןך מכונן את קרן הליזר לאנשים אחרים או לעצמך.
- ◀ השתמש במוצר רק במסגרת גבולות השימוש המוגדרים. אל תכוון את קרן הליזר למראות, לפלאת כרום, לבנים מוברכים וכן הלאה.
- ◀ כדי למנוע שגיאות במידידות יש לשמור על חלונית הליזר נקייה.
- ◀ צית לתקנות הבטיחות הספציפיות למدينة.

2.3 תאימות אלקטромגנטית

אף על פי שמד טווח הליזר עומד בדרישות המחייבות של התקנים הרלוונטיים, **Hilti** אינה יכולה לשלול את האפשרות שקרן החזקה תפריע למד טווח הליזר, מה שעולם לגרום לתקלות בתפקוד שלו. במקרה זה או במקרה של חוסר ודאות אחר במידידות יש לבצע מדידות בקרה. כמו כן **Hilti** אינה יכולה לשלול את האפשרות שהמכשיר יפריע למכשירים אחרים (כמו מכשירי ניוט של מטוסים). מד טווח הליזר תואם את דירוג A; אין אפשרות לשלול הפרעות באזרחי מגוריים.

2.4 עבודה בטוחה עם מכשירי ליזר


- ◀ רק אנשים שעבורו הדרכה מתאימה רשאי להפעיל מכשירים בדירוג ליזר 2.
- ◀ יש להקפיד שקרן הליזר אינו עברות בגובה העיניים.
- ◀ יש לנகוט אמצעי זהירות כדי לוודא שקרן הליזר אינה פוגעת בשוגג בשטחים מחזירים, כגון מראה.
- ◀ יש לנகוט אמצעי מנע כדי לוודא שאיש אינו מביט ישירות לקרן.
- ◀ לקרן הליזר אסור לצאת לאזרחים שאינם תחת השגחה.
- ◀ כבה את קרן הליזר כשהאין משתמש בה.
- ◀ מנע הפעלה של קרן הליזר על ידי אנשים לא מורשים – ובמיוחד ילדים; לשם כך הפעיל את בעילת המכשיר בהגדרות המכשיר.

- מכשיiri ליזיר שאינם בשימוש יש לאחסן במקום שאינו נגיש לאנשים לא מורשים.

2.5 אמצעי בטיחות כלליים

- לפניהם השימוש בדוק את המוצר לאייתור נזקים. אם איתרת נזקים, פנה למעבדת שירות של **Hilti** כדי לתקןם.
- לפניהם השימוש בדוק למען בטיחותם את ההגדרות והគונונים של המוצר שקבעתו בעצמו.
- אין להשתמש במוצר בזמן נהיגה ברכב או בזמן הפעלת מכונה.
- אם המוצר נפל או ספג פגיעה מכנית אחרת יש לבדוק את רמת הדיקוק שלו.
- אף על פי שהמוצר מיועד לעובדה בתנאים הקשים של אתרי בנייה, יש לטפל בו בדירות כמו בכל מדידה אחרים.
- אף על פי שהמוצר מוגן מפני חDIRת לחות, יש לנגב וליבש אותו לפניהם אחסונו מכל להובלה.
- שמור כלים שאינם בשימוש הרחק מהישג ידם של ילדים. אל תאפשר לאנשים שאינם יודעים כיצד להשתמש במוצר או שלא קראו את ההוראות להשתמש במוצר. כל עבודה הם מסוכנים כאשר משתמשים בהם אנשים חסרי כיסיון.

3.1 סקירת המוצר

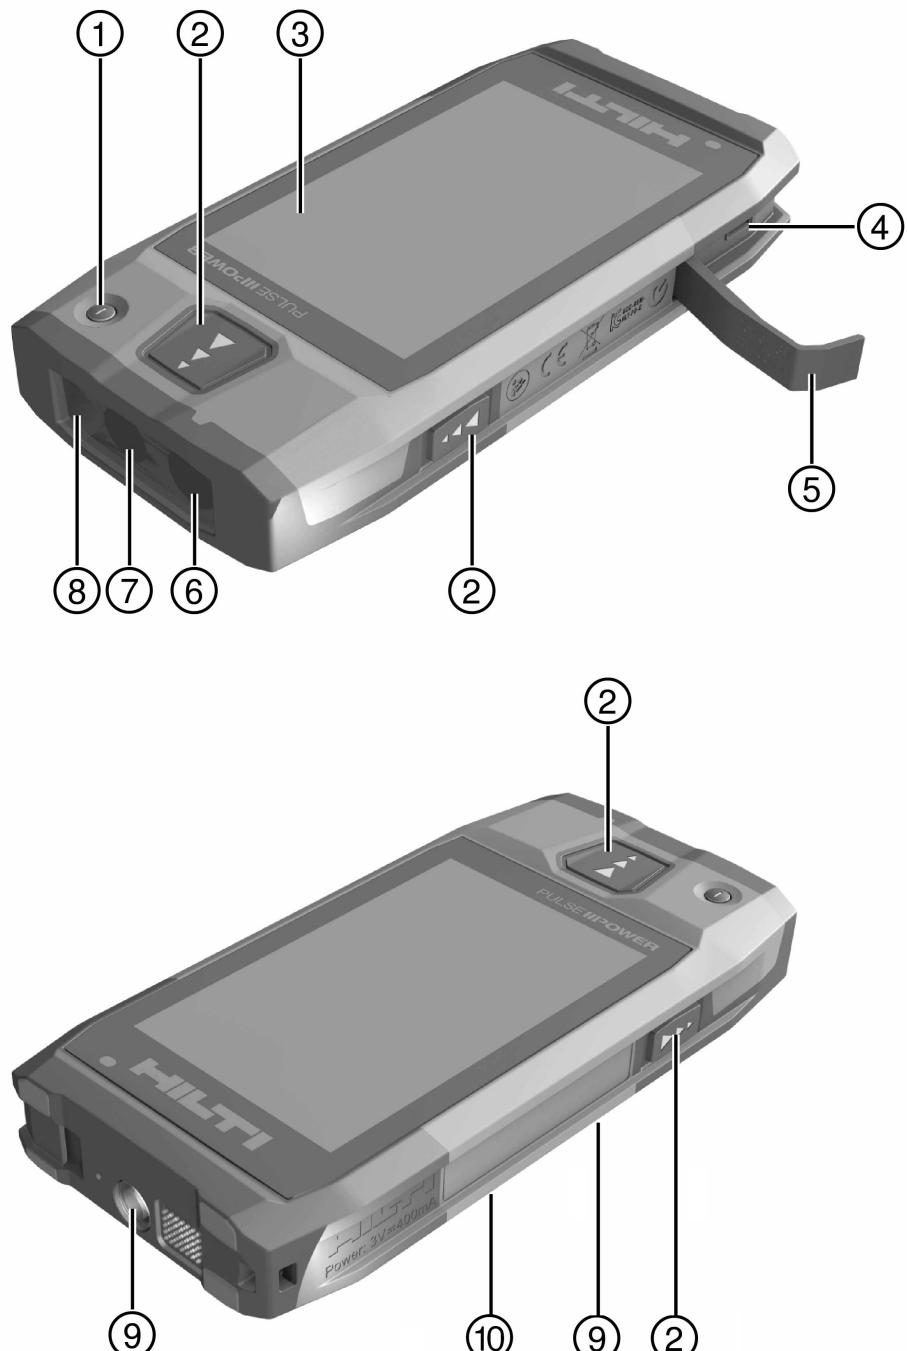

② לחצבי מדידה

① מtag הפעלה/כיבוי

⑦ עדשת מצלמה	⑧ זכוכית CISCO	⑨ תבריג לחצובה	⑩ מצלמת תיעוד (PD-CS)	③ מסך מגע
				④ שקע מיקרו USB, סוג B
				⑤ מכסה
				⑥ יציאת הליזר

3.2 שימוש בהתאם ליעוד

ה מוצר המתווך זהו מוד טווח ליזר. הוא מיועד למדידה של מרחקים. ניתן להשתמש במרחקים שנמדדוו לצורך חישובים שונים, לדוגמה לחישובי שטח, נפח, מרחקים מינימליים/מקסימליים, חישובי פיתגורס, מרוחקים וכן הלאה.

3.3 מפרט אספקה

מוד טווח ליזר, לולאט איחוד, נרתיק למכשיר, כוד מדידה קצר, שניאי עם כבל USB. מוצרים נוספים המואושרים עבור המוצר שלו תמצאו ב-**Hilti Store** או באינטרנט בכתבות: www.hilti.group.

3.4 סוללה נטענת מובנית

במוצר מובנית סוללה ליתיום יונ נתענת בקיבולת 3220 mAh , שאיןיה ניתנת להסרה. סוללת הליתיום-יון עומדת בכ-500 מהזרוי טעינה מלאים או לפחות 2 שנים של שימוש בינו לבין עד גביה. כאשר הסוללה ריקה משך הטעינה הוא כ-3 שעות, בתנאי שימושם בכבול ה-USB ובהתאם לשוטףן על ידי **Hilti**.

הערה

אם בתחילת תהליך הטעינה ריקה למגרי או כמעט למגרי, ניתן שסמל הטעינה יציג רק לאחר כ-30 דקות.

בטמפרטורת גבהות מ- 30°C (86°F) מתארך משך טעינת הסוללה באופן משמעותי. דמי הטעינה המרביים תקפים לטמפרטורות פנים רגילות ללא קירינת שימוש ישירה. כאשר הטמפרטורה החיצונית גבוהה מאוד, לדוגמה 32°C (90°F) ומעלה, משך הטעינה יהיה ארוך יותר. ניתן אפילו שתהליך הטעינה יופסק אוטומטית עקבו זמן מה כדי לאפשר לסוללה להתפרק לטמפרטורה בטוחה.

טעינה באמצעות המחשב עם כבל ה-USB שסופק על ידי **Hilti** יאריך את משך הטעינה. שימוש בכבול מיקרו USB של יצור אחר אינו מומלץ. אם אין ברירה אלא להשתמש בכבול של יצור אחר, יש לוודא קודם לכך שהוא מתאים למקורות חשמל במתח של 5.0 וולט ובהספק של 2.1 אמפר. טעינה באמצעות כבל מיקרו USB של יצור אחר עשוי להימשך זמן ארוך יותר באופן ממוצע. שימוש תדיר בכבול מיקרו USB של יצור אחר במקומות במקומות בכבול שסופק על ידי **Hilti**, עשוי ל��rac את משך חיי השירות של הסוללה.

- ◀ טען את הסוללה למגרי לפני השימוש הראשוני במכשיר.
- ◀ אין לטען את המכשיר תחת קירינת שימוש ישירה.
- ◀ אם תהליך הטעינה הופסק או שהוא ממשך זמן ארוך מאוד, נסה לטען את הסוללה במקומות קרייר יותר.
- ◀ אם נדמה לך שתהליך הטעינה אינו מתנהל כראיל או כאשר הסוללה מתרוקנת כבר אחרי שעתיים של עבודה, פנה לשירות של **Hilti**.
- ◀ טען את הסוללה בעדרת כבל המיקרו USB שסופק על ידי **Hilti**. חבר את הכבול או לשקע ה-USB במחשב או לשקע באמצעות המתאם המצורף לשקע חשמל.
- ◀ אם אתה מאבד את כבל המיקרו USB או המתאם המקוריים, פנה בבקשה לשירות של **Hilti** כדי לרכוש חלופיים.

אזהרה

סכנת פציעה מקרינת לייזר! פתיחה לא מקצועית עלולה לגרום להקרנה לא מבוקרת של לייזר.



- ◀ הבא את המכשיר לתיקון אך ורק במעבדות שירות של **Hilti**.

- ◀ לצורך החלפת סוללה יש להביא את המכשיר למעבדת שירות של **Hilti**, כיוון שלאחר החלפת סוללה צריך לכיל מחדש את המכשיר.

3.5 נתוניים טכניים

3.5.1 מדידת מרחק

הערה



מדידת הדיק במדידת מרחק ושיפוע השפעות דוגמת תנודות טמפרטורה חזקות, לחות, חבטות, נפילה וכדומה יכולות להשפיע על הדיק. אם לא צוין אחרת, המכשיר כוביל לפי תנאי סבב סטנדרטיים (MIL-STD-810G). במדידת מרחקים יש לנקח בחשבון שגיאה נוספת נוספת של 0.02 מ"מ למטר. בקדמת היחס למדידות של שיפועים היא לגבי המכשיר.

PD-CS	PD-C	
<ul style="list-style-type: none"> • מדידה בודדת • מדידת תחום 	<ul style="list-style-type: none"> • מדידה בודדת • מדידת תחום 	סוגי פעולה
1.0 ± 0.02 מ"מ	1.0 ± 0.02 מ"מ	דיק במדידת המרחק (ס, סטייה סטנדרטית)
$\pm 0.3^\circ$	$\pm 0.3^\circ$	דיק במדידת שיפוע (ס, סטייה סטנדרטית)
0.20 רדי... 0.45 רדי... 0.45 מיל.- רד'	0.20 מיל-רד... 0.45 מיל-רד	התבדרות הקאן
0 מ'... 200 מ' (0 רג'... 656 רג')	0 מ'... 200 מ' (0 רג'... 656 רג')	תחום מדידה עם לוח מטרה
< 2 מ' < 6 רג' - 10 אינץ')	< 2 מ' < 6 רג' - 10 אינץ')	מרחק מכימלי של היעד בעבודה עם נקודת ליזר וצלב מרכז לדום
< 5 מ' < 16 רג')	< 5 מ' < 16 רג')	מרחק מכימום של היעד בעבודה עם נקודת ליזר וצלב מרכז בדום מקסימלי

3.5.2 מסך מגע

חוויים	מסך מגע
תצוגה קבועה של מרחקים, מצב עבודה ורמת טעינה הסוללה	אלכסון של צג המגע

3.5.3 אספקת חשמל

סוללה ליתיום-יון	מבנה
מתוך נקוב	3.7 וולט
קיבולת	3,220 מיליאמפר-שעה
זמן המתנה	< 200 שעות
משך הזמן עד להפעלת מצב מכונה אוטומטי	20 דקות
משך פעולה בתנאים רגילים, עם תצוגה פעילה	≈ 10 שעות
זמן טעינה (תלויה במתען ובכבל הטעינה)	≈ 3 שעות
מתוך מבוא של המתען (קלט)	100 וולט... 240 וולט
תדריות מבוא של המתען	50 הרץ... 60 הרץ
זרם נקוב של המתען	0.5 אמפר

עברית

51

תקן התקע של הטעינה	מיקו USB	זרם טעינה	5 וולט	מתח מוצא של המטען
			10 מיל. אמפר ... 2,100 מיל. אמפר	

3.5.4 ליזר

PD-CS	PD-C	
גלויה, דירוג ליזר 2, IEC/EN 60825- 1:2007; Class 2 CFR 21 § 1040 (FDA)	גלויה, דירוג ליזר IEC/EN 60825- 1:2007; Class 2 CFR 21 § 1040 (FDA)	דירוג ליזר
635 ננומטר	635 ננומטר	אורך גל
> 1 מיל. ואט	> 1 מיל. ואט	הספק מוצא
20 שניות	20 שניות	משך הזמן עד להפעלת מצב החיסכון באנרגיה

3.5.5 מאפייני מוצר נוספים

PD-CS	PD-C	
7,000 ≈ הערה הרכיבים הנთוקים מבוססים על תוצאות אופייניות של מדידה ישירה עם צלום יעד. המקסימום בפועל תלוי בסוג התוצאה וברוחולוציה של הצלום.	≈ 3,000 הערה הרכיבים הנתוקים מבוססים על תוצאות אופייניות של מדידה ישירה עם צלום יעד. המקסימום בפועל תלוי בסוג התוצאה וברוחולוציה של הצלום.	קיובות ذיכרון הבדיקה לשמירה של תוצאות מדידה
5.0	5.0	רזולוציה מרבית של מצלמת היעד [מגה-פיקסלים]
5.0	5.0	מצלמת תיעוד [מגה-פיקסלים]
2.1 + EDR (3 Mbit/s)	2.1 + EDR (3 Mbit/s)	גרסת Bluetooth
עמידה בדרישות תקן: IEEE 802.11 b/g/n 11 נטמכים: 1 - 11	•/•	Wireless LAN
15.39 dBm	12.3 dBm	עוצמת שידור Bluetooth
18.47 dBm	•/•	עוצמת שידור Wireless LAN
... 2,400 מגה הרץ ... 2,483.5 מגה הרץ	2,400 מגה הרץ ... 2,483.5 מגה הרץ	תדר
260 גרם (9.2) אונקיה	260 גרם (9.2) אונקיה	משקל
154 מ"מ × 75 מ"מ × 24 מ"מ (6.1 אינץ' × 3.0 אינץ' × 0.9 אינץ')	154 מ"מ × 75 מ"מ × 24 מ"מ (6.1 אינץ' × 3.0 אינץ' × 0.9 אינץ')	 מידות
IP54	IP54	סוג הגנה

PD-CS	PD-C	
50 °C ... -15 °C (122 °F ... 5 °F)	50 °C ... -15 °C (122 °F ... 5 °F)	טמפרטורת עבודה
50 °C ... -15 °C (122 °F ... 5 °F)	50 °C ... -15 °C (122 °F ... 5 °F)	טמפרטורת אחסון

3.6 עקרון פעולה

המכשיר מודד את המרחק לאורך קרן הליזר עד שהקרן פוגעת במשטח מחזיר. באמצעות נקודת הליזר ניתן לזהות את היעד חד-משמעות. טווח הליזר תלוי ברמת האור בסביבה וכן במידה ההחזר של המשטח بعيد המידה.

3.7 ניוט על הצג

3.7.1 הכנה לעבודה

זהירות




סכנת פציעה! תחילת פעולה לא מכונת של המוצר.

◀ הסר את הסוללה לפני שאתה מבצע כוונונים כלשהם במכשיר או מחליף אביזרים.

ציית להוראות הבטיחות והאזהרות שבתייעוד זה ולאלה המצוינות על המוצר.

3.7.2 דף פתיחה

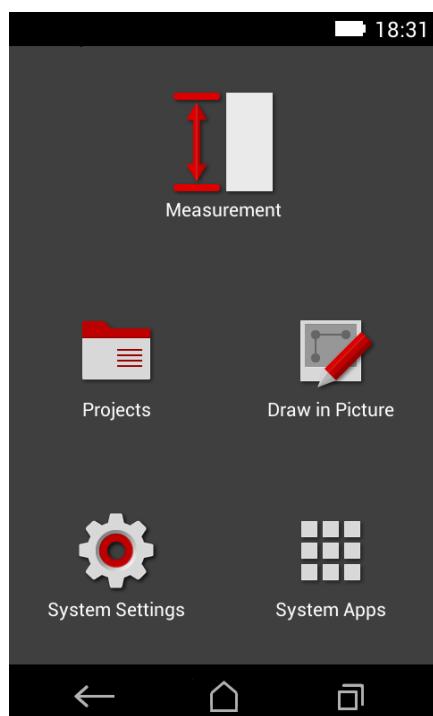


דף הפתיחה של המכשיר מכיל קישורים ליעדים הבאים:

- אפליקציה המדידה
- רשימת תיקיות הפרוייקטים באפליקציה המדידה
- הפעוקציה 'شرط' בתמונה' באפליקציה
- הגדרות המכשיר

(שים לב: את הגדרות עבור אפליקציה המדידה תמצא בתפריט 'Application Settings' ברשימה הנפתחת 'פונקציות' באפליקציה המדידה) • אפליקציות מערכתי, בינהן המצלמה עבור צלומים וסרטונים, גליה שבה ניתן לצפות בתצלומים וסרטונים וכן מחשבון.

3.7.3 אפליקציית מדידה

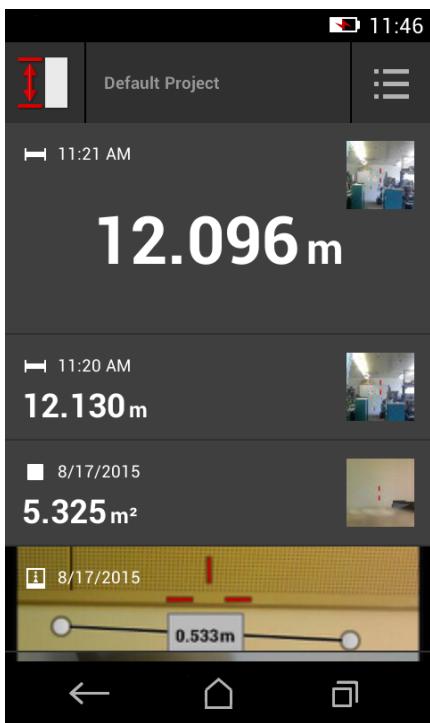


אפליקציה מדידה היא יישום המרכז לבייזו מדידות. היא מציעה מגוון של פונקציות מדידה, שבחלקן משלימות בעדרים. אפליקציית המדידה שומרת את תוצאות המדידה בתיקיות פרויקטים, שאוטם אתה יכול ליצא ולשלוח באמצעות Bluetooth (PD-CS 1-PD-C) להתקנים תומכי Wi-Fi (PD-CS). ובאמצעות (PD-CS).

הדף הראשי של אפליקציית המדידה מכיל את התוכן הבא:

- רשימת תיקיות הפרויקטם; כדי להציג אותה יש לגעת בפרויקט הפעיל, שאותו נמצא למעלה במרכז סרגל התפריטים.
- רשימת התוצאות של הפרויקט הנוכחי; היא מציגה את כל המדידות בסדר כרונולוגי, החל מהතוצאה החדשה ביותר ועד לתוצאה הישנה ביותר בסוף הרשימה. נגיעה בתוצאה מסוימת תציג פרטיהם על תוצאה זו.
- הסמל ☰ ע過ר הרשימה הנפתחת 'פונקציות'; הוא נמצא בפניה הימנית עליונה של המסך. הרשימה הנפתחת מכילה את כל פונקציות המדידה, (ראה סקירת הפונקציות, ← עמוד 58) וכן בסוף 'Application Settings' את התפריט עם ההגדרות של אפליקציית המדידה.

3.7.4 סרגל כלים

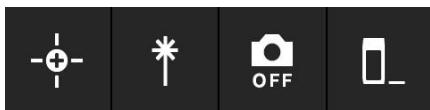

סרגל הכלים מצוי במהלך המדידה. הוא מאפשר לך להפעיל מדריכים, להחליף בין ליזר קבוע לסטנדרטי, להפעיל את מצלמת היעד ולשנות את נקודות הייחוס.

3.7.5 סרגל ניווט



בקצה התחתון של המסך ישנו תמיד סרגל ניווט, המכיל את האלמנטים הבאים:

- ←: סגירת פונקציה וחרדה לתצוגה הקודמת או לתריט האחרון שהוצג.
- ☰: מעבר לדף הפתיחה.
- ☰: הצגת כל היחסומים הפעילים, סגירה או בחירה שלהם.

3.8 לחיצים וסמלים לצורך הפעלה וסיום של מדידות

לאחר הדלקת הליזר ניתן להפעיל מדידה באמצעות אחד משלשות לחצני המדידה מגומי. במרבית הפונקציות אפשר להפעיל מדידות גם באמצעות סמל לחץ המדידה על הצג ברגע שהממשק ממוקם וmonic למדידה.

אם אתה מבצע מדידה שבה לפני הפעלת המדידה מוצג המרחק, תוכל לחוץ על המרחק המוצג כדי להפעיל את המדידה. במדידת תחומים תוכל לסיים את המדידה גם בנטישה במרחב המוצג.

הערה

לחיצה על אחד משלשות לחצני המדידה תוביל אותך לשירות לפונקציה 'ישיר'.



3.8.1 סיום מדידות ופונקציות

באמצעות ← תוכל לסיים כל מדידה או פונקציה.

3.9 חישון שיפוע

חישון השיפוע המובנה ב-C-PD ו-B-PD-CS מסיע בחישובים במדידות עקיפות. חישון השיפוע המובנה מודד את השיפוע האופקי. כדי להשיג מדידות מדויקות ככל האפשר בשיפוע יש לכיל באופן סדר את חישון השיפוע. שים לב להוראות בתוכנת המכשיר בנוגע לכיוול סדר. כיל את המכשיר גם לאחר שינוי טמפרטורה או אם המכשיר קיבל מכאה.

המכשיר אינו מיועד לביצוע מדידות זוויות מדויקות. למטרה זו יש להשתמש בפלס או כלי מדויק אחר.

3.10 אמצעי עדר למדידה

3.10.1 מאריך מדידה 72 PDA

מאריך המדידה 72 PDA עשוי אלומיניום וככל ידית פלסטיק לא מוליכה. כאשר מבריגים את מאריך המדידה 72 PDA (אביזר אופציוני) לבסיס המכשיר, יוצג דוח-שיכון שבו יש לאשר את בחירת מאריך המדידה. אפשר להבריג את מאריך המדידה 72 A PDA גם לגב המכשיר.

3.10.2 מאריך מדידה קצר

המושך מכיל מאריך מדידה קצר (חולד מדידה). חולד מדידה זה תוכנן במטרה לאפשר בקודות ייחוס במקומות שהגישה אליהם באמצעות הבסיס השטוח של המכשיר קשה.

חולד המדידה יעל מאד כשייש צורך למודוד אלכסוניים של חדר או כאשר הגישה לנקודות הייחוס קשה. שים לב להערה בנוגע לשיפור הדיקוק במדידה ← עמוד 71.

- ◀ השימוש בחולד המדידה באופן סדר גם במדידות עקיפות מסוימות ובמדידות פיתגורס, כדי שתוכל לשמר על אותה בקודות ייחוס עבור כל חלקי המדידה.
- ◀ כשחוד המדידה אינו בשימוש הכנס אותו למחזק שבנרתיק המכשיר.
- ◀ במקרה המקורי חולד המדידה מעוגל בקצתו. אולם בעקבות שימוש תדיר בחולד המדידה החולד עשוי להשתפר.
- ◀ אם חולד המדידה נעשה שטוח בעקבות השימוש או אם איבדת את חולד המדידה, פנה>bבקשה לשירות של Hilti.


3.10.3 חיבור מאריך מדידה לבסיס המכשיר

הערה



הזרחי האוטומטי של הארכת המדידה צריך להופיע וצריך להתחשב בו רק כאשר הארכת המדידה המקורית של Hilti דגם 74 PDA (גם קצר עבור PD-CS-1-PD-C, כולל באסתפה) או הארכת המדידה המקורית של Hilti דגם 72 PDA (גם ארוך עבור PD-E, PD-C, PD-1-PD-C, PD-CS-1-PD-C, לרכישת בנפרד) מוברגת למכשיר.

אפשר להשתמש גם בחציבותות אחרות. אם אתה מבריג חציבה אחרת לבסיס המכשיר, עליך למודוד במדוק את היחסט ולהזין אותו ידנית למכשיר.

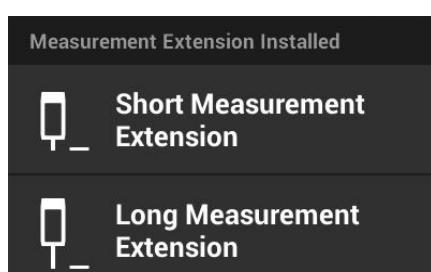

1. הפעיל את המכשיר וחרור את נעילת הצג.
2. הברג את מאריך המדידה לבסיס המכשיר.
 - ▷ כתעת איתה תידרש לבחור.
- 3.בחר את מאריך המדידה או השן היחסט.

3.10.4 לוחות מטרה

לצורך מדידה של טווחים גדולים יותר וכאשר תנאי האור אינם טובים, אנו ממליצים להשתמש בלוחות המטרה 50 PDA, 51 PDA או 52 PDA. כדי להבטיח תוצאות מדידה אמינות יש למודוד בדווית ישרה עד כמה שאפשר ללווח המטרה.

כדי להשיג תוצאות מדידה מדויקות מאוד יש להוסיף את הערך 2 מ"מ (0.1 אינץ') למרחק שבמדד עקב עובי לוח המטרה 50 PDA 1-52. ניתן להזין ערך זה ידנית. בחר לפנוי או אחורי המדידה את הגדרת הייחוס  והזן ידנית נתון מספרי למרחק, של 0.0025 מ' או $16/_{16}$ אינץ'.

3.10.4.1 לוח מטרה PDA 50

לוח המטרה 50 PDA עשוי פלסטיק מוצק עם ציפוי מיוחד מחדיר אור. עברו מרוחקים של החל מ-10 מטרים מומלץ להשתמש בלוח המטרה כאשר תנאי האור אינם טובים.

3.10.4.2 לוח מטרה PDA 51

לוח המטרה 51 PDA אין ציפוי מחדיר אור, והוא מומלץ לשימוש בתנאי תאורה לא טובים ובערחוק מדידה קצרים יותר.

3.10.4.3 לוח מטרה PDA 52

לוח המטרה 52 PDA מצופה באוטה שכבה מחזירת אור כמו 50 PDA, אולם הוא גדול יותר (210×297 מ"מ). לפיכך קל הרבה יותר לולוח המטרה הזה מרוחקים גדולים.

3.11 מדידה של מרוחקים קצרים מאוד

המרחק הקצר ביותר שאפשר למדוד באמצעות המכשיר בתנאים אופייניים הוא כ-15 ס"מ (ארה"ב: 6 אינץ'). המרחק המינימלי למשטח אמין יכול להיות עד 1.5 מטרים אם צבע פני השטח של היעד אינו מחדיר אור שצבעו שחור כהה או כאשר לפני השטח יש מרקם רך, קטיפתי. אם המדידה אינה אמינה, המכשיר לא יראה תוצאה.

3.12 דיקוק המדידה

מידת הדיקוק של מדידת המרחק באמצעות לייזר מנוקודת הייחוס של המכשיר ועד לנקודת הליזר מאפשרת סטייה של לא יותר מ-1.0 מ"מ. אם אי אפשר להגיע לעד המדידה או כשיישנו אוור שמש בהיר מאוד שאינו מאפשר רמת דיקוק זו, לא תוצא תוצאה.

רמת הדיקוק במדידה באמצעות הפונקציות 'עקב', 'פיתגורס' ו-'Picture' עשויה בתנאי שימוש אופייניים ללא שימוש קפדי בחצובה לסתות משמעותית לכך או לכאן או לכאן מהערך של 1.0 מ"מ. הסטייה תלולה ברמת הדיקוק שבה שמרת על נקודת הייחוס במהלך כל המדידות הדרושים לתוצאה הנוכחית. שימוש סדייר במאיריך המדידה הקצר מקל על הדעת המכשיר סביר נקודת התחלת בלתי משתנה. לעומת זאת סיבוב המכשיר שלא בסיווג מאיריך המדידה או חצובה תוביל לסתיה קלה אך רציפה מנוקודת הייחוס המדיקת.

מידת הדיקוק של המדידה באמצעות הפונקציה 'Picture' תלולה באמ המכשיר ממוקם בדווית מדויקת של 90° לעד (דווית ישרה – אופקיות כמו גם אנכית) ובאם כל פני השטח שנכללים בתצלום היעד במצבים אכן באותו מישור, כמו לדוגמה חדיית מבנה או תקרת חדר. הטבלה הבאה מציגה סטיות אופייניות במדידות בתצלומים, כאשר התצלום לא צולם מדויקת של 90° .

שגיאה עקב צילום מנוקודה שאינה בדווית ישרה לךיר

הטבלה הבאה מחייבת שמירה על דווית אנכית של 90° ביחס לךיר בעדרת חיווי השיפוע של מד טווח המרחק.

אחדות השגיאה המצויינים בטבלה מצינים את הסטייה של תוצאה המדידה מהמרחק המששי.

הגבלות

- הנתונים אינם לוקחים בחשבון יכול אינדיבידואלי של מכשירים.
- העריכים תקפים לממדידות בידי חופשית.
- שימוש בחצובה מגביר את מידת הדיקוק בכ-0.5%.

אורך הקו המוצג על המסק ביחס לרוחב המסק (ללא זום)			
< 30% עד 50%	> 50% עד 30%	< 30%	סטייה מדוזית אופקית של 90° ביחס לקיר
±2.2%	±2.5%	±4.5%	0°
±4.9%	±3.7%	±5.2%	מקס. ±3°

3.12.1 'Picture' למתקדמים

משתמשים מתקדמים יכולים בעזרת הפונקציה 'Picture' בשימוש קפדי למדוד מרחק לאורך קו אופקי או אנכי, לאחר שכוונו אליו את הליזר בזווית של 90°. יש להשתמש בשיטה זו בזרות, מאחר שככל המרחוקים שנמדדים בתמונה ואיןם נמצאים לאורק הקו שצולם בזווית 90°, יהיו בלתי מדויקים בצורה משמעותית.

3.12.2 השפעות של פני השטח על המדידה

מודול הליזר של **Hilti** פותח על בסיס PulsePower (מיילוני פולסים לשנייה) ומספק את התנאים הטובים ביותר לקילטה של החזרות קרון ליזר ברוחות כדי לחשב מתוכן מדידה מדויקת. עם זאת ישנים מצבים שבהם המכשיר אינו יכול מסווג החזרות אוור מהיעד. הבנת העקרון זהה מאפשרת להיעדר באמצעותים שונים, כגון לוחות מטרה של **Hilti**, שכיתן לרכוש כאביזרים נפרדים. השימוש בלוחות מטרה גורם להחזרת כמות רבה יותר של אור מהיעד למיכשי. דוגמאות למצב שבו אין החזרת אור מספקת כוללות החמצת היעד (לדוגמה קרון ליזר שעוברת ליד התקירה ומכוונת לשמיים), פני שטח מאירים ולא מחזירים, גורמים מפריעים כגון ערפל, גשם או אבק בין המכשיר לעד, פני שטח כהים ולא מחזירים או בעלי מרקם דמיי קטיפה או חומרים בולעיים או גבן קצף או משטחים מחוספסים.

3.12.2.1 משטחים מחוספסים

במדידה על משטחים מחוספסים, כגון טיח גס, נוצר ערך ממוצע, שמעירך את מרכז קרון הליזר גבוה יותר מאשר את אזור השולדים.

3.12.2.2 פני שטוח עגולים או משופעים

כאשר מכונים לפניו שטח משופעים מאוד, יתכן בתנאים מסוימים שאנרגיית אור מועטה מדי תוחזר למיכשי או בכיוון בזווית ישירה שאנרגיה רבתה מדי תוחזר למיכשי. בשני המקרים מומלץ להשתמש בלוח מטרה (PDA 50, PDA 51 או 52).

3.12.2.3 פני שטח רטובים או בוהקים

שלולית שהמים בה אינם מדדים משקפת את העכנים ומהציג את האור של השמיים. באופן דומה משטח רטוב ובוהק יציג את קרון האור. כאשר פני השטח שלוים מכונים רטובים ובוהקים, חשוב לבצע את המדידה מזווית ישירה עד כמה שאפשר, אחרת האור יוחזר לכיוון אחר, ואור מועט מדי יוחזר למיכשי, מה שלא יסייע לחישוב המדידה. גם פני שטח מעוגלים עשויים להקשות על החזרת כמות מספקת של אור לכיוון המכשיר לצורך המדידה.

3.12.2.4 פני שטח שkopים או בולעי או

באופן עקרוני אפשר למדוד מרחקים לחומרים מעבירי אור, כגון נזליים, קלקר, ספוג וכדומה. האור חודר לחומר אלה, מה שעשויה להוביל לשגיאות במדידה.

3.12.2.5 הפרעות בין המכשיר לעד המדידה

שגיאות במדידה עשויות להתרחש כאשר, לדוגמה, מודדים דרך שימושות זכוכית או כאשר אובייקטים אחרים, כגון אבק וארוסול נמצאים בין מקור הליזר לעד המדידה.

4 הוכרת אפליקציית המדידה

4.1 פונקציות ועדרים של אפליקציית המדידה

4.1.1 פונקציות

בתפריט הנפתח 'פונקציות' של אפליקציית המדידה אפשר לבחור פונקציות מקבוצות הפונקציות הבאות:
קבוצות פונקציות ופונקציות

פונקציות	קבוצת פונקציות
'ישיר'	'ישיר'
'Draw in Picture' 'Measure from picture'	'צלום'
'Rectangle' 'Volume Room' 'Volume Cylinder'	'שטח ונפח'
'עקי' 'אנכי' 'מעל לראש' 'לא מזרחי' 'מיב/מקס/זלטא'	'עקי'
'פיתגורס I' 'פיתגורס II' 'פיתגורס III'	'פיתגורס'
'טרפז' 'טרפז I'	'טרפז'
הגדירות עבור אפליקציית המדידה	'System Settings'

4.1.2 תמייה במדידות באמצעות מדבקים, קובץ דמן ומצלמת היעד



בחולנות הדו-שים המכילים את הסמל בסרגל הכלים (← עמוד 54) אפשר בתחלת העבודה להפעיל את העדרים הבאים, שיסייעו לך במדידות מרחוק:

- מדבק** מסיע בכרך שהוא מפעיל מדידה באופן אוטומטי כאשר עליך למדוד מדידה אופקית או אנכית במדויק או כאשר עליך למדוד את המרחק הארוך או הקצר ביותר בזמן מדידה רציפה.
- קובץ דמן** מאפשר להפעיל מדידה 3, 5, 10 או 15 שכיות לאחר לחיצה על לחץ המדידה.
- דיהוי יעד המדידה באמצעות **מצלמת היעד** מסיע בכיוון ליעדי מדידה קשיים לדיהוי.

שילובים אפשריים של עדרים ופונקציות

עדר	פונקציה		
	מדנק	קובץ דמן	מצלמת יעד
✓	✓	✓	'ישירה'
✓	✓	✓	'Measure from picture'
✓	✓	✓	'Draw in Picture'
✓	✓	✓	'שטח ונפח'
✓	✓	✓	'עקי'

עדך			פונקציה
מצלמת יעד	קוצב דמן	מדנק	
✓	כן, במדידה הראשונה. לא במדידה השנייה (רק מדידת זווית)	כן, במדידה הראשונה. לא במדידה השנייה (רק מדידת זווית)	'לא מחדיר'
✓	לא ישים	לא ישים	'מין/מקס' /'דלתא'
✓	✓	✓	'פיתגורוס'
✓	✓	✓	'טרפז'

4.1.3 לייזר סטנדרטי (מדידה בודדת)



במצב 'Standard Laser' לחיצה על לחץ המדידה תפעיל מדידה, ואז הקרון תכבה.

המצב הנוכחי – 'Standard Laser' או 'Permanent' – מוצג כסמל בשורת המצב של 'Laser'.

4.1.4 לייזר קבוע (מדידה מרובה)



במצב 'Permanent Laser' קרון הליאזר לא תכבה לאחר לחיצה על לחץ מדידה וביצוע המדידה, אלא היא תישאר פעילה. כך אפשר לבצע כמה מדידות במהלך פעולה. בזו אחר זו ללא צורך מחדש את קרון הליאזר. המצב הנוכחי – 'Permanent' או 'Standard Laser' – מוצג כסמל בשורת המצב של 'Laser'.

4.1.5 תמיכה של מצלמת היעד



כיוון לעד בסיוו' המצלמהאפשר כוונון מדויק של מדטווח הליאזר גם למרחקים גדולים.

מרחיק מינימלי לצורכי השימוש בצלב המיקוד של מצלמת היעד
בעדרת מצלמת היעד קל יותר למקם במדויק את נקודת הליאזר. היא שימושית גם בעבודה בחוץ באור יום וגם בעבודה למרחקים גדולים בתחום, ככלומר בכל מצב שבו קשה או בלתי אפשרי לזהות את נקודת הליאזר. מצלמת היעד והלייזר מסודרות זו לצד זו במרחב של 2 עד 3 סנטימטרים (איביצ' אחד). בעקבות זאת, במדידה של טווחים קצרים אי אפשר לאחד את קרון הליאזר והמרכז של צלב המיקוד. זהו מצב תקין והוא נגרם עקב אותה אשליות פרלקס הגורמת לנו לראות שתי אצבעות כשהאנחנו מחדיקים אצבע אחת על קצה האף. נקודת הליאזר וצלב המיקוד מותאדים כשבוזם כבוי החל ממרחק של 2 מטרים (כ-6.5 רגליים) או החל ממרחק של 5 מטרים (כ-16 רגל) עם פונקציית זום מקסימלית.



המדידה תחווסף תמיד מנוקודת הליאזר, ללא תלות במרכז צלב המיקוד.

זום ובהירות

כאשר מצלמת היעד פועלה אפשר לכוון זום ובהירות באמצעות נגיעה והחלקה על המנסן.

זום

גע בקצת התחתון של הצג כדי להפעיל את כוונון הדום. מלבן חיווי בקצת העליון של הצג מציג את ההגדלה הנוכחית באחיזות. החלק את האצבע בצורה אופקית בקצת התחתון של הצג כדי לווסת את ההגדלה.

בהירות

גע בקצת הימני של הצג כדי להפעיל את כוונון הבהירות. מלבן חיווי בקצת הימני של הצג מציג את הבהירות הנוכחית באחיזות. החלק את האצבע אנכית בקצת הימני של הצג כדי לווסת את הבהירות של תמונהן מצלמת היעד המוצגת על הצג.

4.1.6 נקודות ייחוס למדידה

נקודות ייחוס

נקודות הייחוס היא חלונית יציאת הליזר, ככלומר הקצה הקדמי של המכשיר.	
נקודות הייחוס היא תבריג החצובה בגב המכשיר.	
נקודות הייחוס היא תבריג החצובה בסיס המכשיר.	

מד טווח הליזר יכול למדוד מרחקים מ-3 נקודות מגע שונות או שלוש נקודות ייחוס שונות. כדי להחליפן בין חלונית הליזר, בסיס המכשיר והתבריג בצד התיכון של המכשיר יש להשתמש בתפריט 'נקודות ייחוס למדידה' בסרגל הכלים.

בעת הברגה של מאריך מדידה או של חצובה לבסיס המכשיר (פריט (9) בסקירת המוצר) המכשיר יציג שאלה, שבה נדרש לבחור בין מאריך מדידה קצר או ארוך או להזין ערך אחר. המכשיר יוצר בעצמו נקודות ייחוס מאריך המדידה שנבחר. למטרות אחרות – לדוגמה כערך עבור החצובה – אפשר להשתמש בתוצאה של מדידה חדשה, בתוצאה ש谋ורה או להזין ערך מספרי ידנית.

הגדירות היסטט

הפונקציה 'Offset Value' מגדילה או מקטינה אוטומטית את כל המדידות בערך מוגדר. אפשר לקבוע את ערך ההיסטט באמצעות האפשרויות הבאות:

- 'New measurement': מדידת מרחק.
- 'Data': בחירת תוצאה מדידה ש谋ורה.
- 'הזנה מספרית': הדנה מספרית, לדוגמה מרחק שנמדד באופן אחר.

4.2 מדידה בעדרת מדכנים וקוצבי זמן

4.2.1 הפעלה וביטול



באמצעות הסמל אפשר להפעיל את המדנק וקוצב הזמן,YSISIUו לך במדידה. אפשר לשלב את המדנק וקוצב הזמן עם פונקציות מדידה שונות (← עמוד 58). באמצעות האפשרות 'מצב סטנדרטי' אפשר לבטל את המדנק וקוצב הזמן.

4.2.2 מדנק 'Minimal' 'Minimal'

המכשיר מזהה את המרחק הקטן ביותר בזמן מדידה רציפה.

הערה

תוכנית מדידה זו עיליה במיוחד לצורך ביצוע בזמן מדידה רציפה.



4.2.3 מדידת המרחק המינימלי

1. לחץ פעמי אחד על לחצן המדידה.
▷ המדידה הרציפה תתחילה.
2. לחץ שוב על לחצן המדידה.
▷ המדידה הרציפה תסתיים, והמרחק הקטן ביותר שנמדד במהלך המדידה הרציפה יוצג.

4.2.4 מדנק 'Maximal' 'Maximal'

המכשיר מזהה את המרחק הגדל ביותר בזמן מדידה רציפה.

הערה

תוכנית מדידה זו ייעלה במיוחד במקרים של ביצוע מדידה באזור שהגישה אליו קשה, כגון במקרה לתקנה בפינה חדר.

4.2.5 מדידת מרחק מקסימלי

1. לחץ פעם אחת על לחצן המדידה.
 - ▷ המדידה הרציפה תתחילה.
2. לחץ שוב על לחצן המדידה.
 - ▷ המדידה הרציפה תסת祢ם, והמרחק הגדל ביותר שנמדד במהלך המדידה הרציפה יוצג.

4.2.6 מדנק 'Horizontal'

במהלך מדידה רציפה המכשיר מתעד רק ערכים שנמדדו בזמן שיפוע של 0° .

הערה

תוכנית מדידה זו ייעלה במיוחד במקרים של ביצוע מדידה במצב אופקי מדויק אבל אין לך חצובה נגישה; כך תבטיח שמירה על יישור אופקי של המכשיר.

4.2.7 מדידת מרחק אופקי

1. לחץ פעם אחת על לחצן המדידה.
 - ▷ המדידה הרציפה תתחילה.
2. כוון את המכשיר לזרווית של -0° .
 - ▷ בזרווית מדויקת של 0° המכשיר יפעיל אוטומטית את המדידה, לאחר מכן יסימן את המדידה הרציפה ויציג את המרחק האופקי.

4.2.8 מדנק 'אנכי'

במהלך מדידה רציפה המכשיר מתעד רק ערכים שנמדדו בעת נתיה של 90° .

הערה

תוכנית מדידה זו ייעלה במיוחד במקרים של ביצוע מדידה במצב אנכי מדויק אבל אין לך חצובה נגישה; כך תבטיח שמירה על יישור אנכי של המכשיר.

4.2.9 מדידת מרחק אנכי

1. לחץ פעם אחת על לחצן המדידה.
 - ▷ המדידה הרציפה תתחילה.
2. כוון את המכשיר לזרווית של $90^{\circ}+$ או $90^{\circ}-$ בקירוב.
 - ▷ בזרווית מדויקת של $90^{\circ}+$ או $90^{\circ}-$ המכשיר יפעיל אוטומטית את המדידה, אז יסימן את המדידה הרציפה ויציג את המרחק האנכי.


4.2.10 מדידה מושנית באמצעות 'Timer'

בעת מדידה באמצעות הפונקציה 'Timer' המכשיר יפעיל מדידה מושנית לאחר לחיצה על לחצן המדידה. ההשיות האפשרות הן של 3, 5, 10 או 15 שניות.

הערה

אי אפשר לשלב את הפונקציה 'Timer' עם שיטות המדידה בסיווע עדרים.

4.3.1 תוצאות המדידה

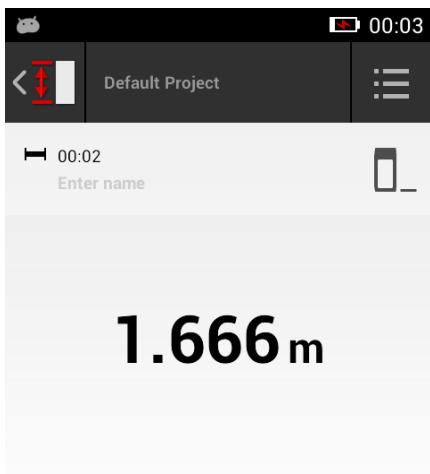

הממשק שומר הودעות, תמונות או יעדים שבמדו ואת החישובים שביצעו. אפשר להוסיף לכל תוצאה הערכה טקסטואלית או תמונה.

בהתוצאות מצלמה ממוצעות ושימוש ממוצע הדיכרון יכול להכיל עד כ-3000 תוצאות מדידה. ברגע שקיבולת הדיכרון נזילה במלואה, תופק הودעה מתאימה. שמיירת הודעות נוספת תתאפשר רק לאחר פינוי מקום בתיקיות הפרויקטים.

כל תוצאה נשמרת בתיקיית פרויקט. התוצאות מוצגות בסדר כרונולוגי; החדשה ביותר נמצאת למעלה.



4.3.2 הצגת תוצאות מדידה

לא תלות ביחידת המדידה שנבחרה בתפריט 'Settings', יישום המדידה מציג את התוצאות המוחשבות ערך מספרי עם שלוש ספרות אחרי הנקודה.

הערה

הערך המוצג עם שלוש ספרות אחרי הנקודה אינו משקף את המרחק בפועל, לא עבור מדידה ישירה ולא עבור מדידה עקיפה. הערך המוצג משקף את החישוב המדוייק ביותר האפשר. במידדות ישירות תיתכן סטייה של $1 \pm 5\text{ mm}$ של ערך זה מהערך בפועל.

התוצאות של מדידות עקיפות אינן מדויקות כמו חישובים מממדידות ישירות.

4.3.3 ניהול תיקיות פרויקטים

באפשרות להוסיף פרויקטים ולשנות את השם של פרויקטים. כאשר אין אף תיקייה פרויקט, תוצאות המדידה יישמרו בתיקייה ששםה 'Default Project'.


אם תמחק את התיקייה 'Default Project', כל התוצאות שבתיקייה זו יימחקו והתיקייה 'Project' תיווצר מחדש.

אפשר לשנות את השם של תיקיות פרויקטים ולמחק אותן. לאחר הפעלה חדשה של הממשק תציג התיקייה האחורונה שהשתמשה בה.

אי אפשר להציג תוצאות מדידה לתיקייה של פרויקט אחר.

◀ לנכון לפני המדידה ודא שבחרת או יצרת את התיקייה הנכונה עבור הפרויקט.

4.3.4 לחיצים לניהול תיקיות הפרויקטים

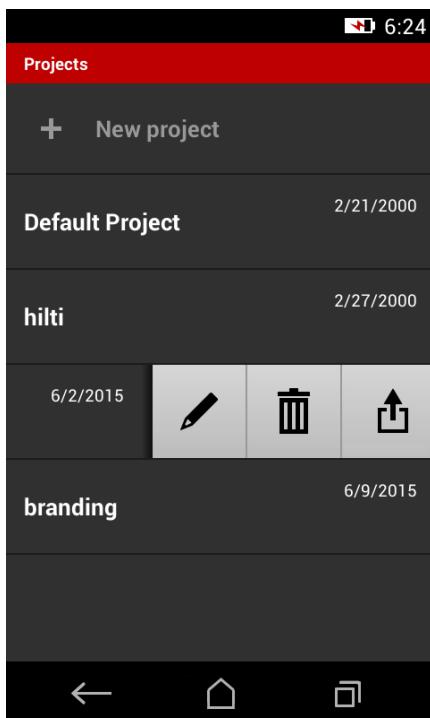

- כדי להציג את הלחיצים לעריכה ולמחיקה של תיקיות פרויקט וכן ליצוא קובץ, החלק את תיקיות הפרויקט שמאלה.
- השתמש בסמל העיפרון כדי לשנות את שם הפרויקט.
- השתמש בסמל פח האשפה כדי למחוק את הפרויקט כולל תוכנו.
- השתמש בסמל הייזוא כדי ליצא את כל התוצאות של הפרויקט הנוכחי לקובץ.
- השתמש בסמל הייזוא כדי ליצא תוצאות מסוימות מהפרויקט הנוכחי, שהשגת באמצעות הפונקציות 'Measure from picture' ו-'Draw in Picture'.

4.3.5 יצוא קבצים

PD-CS-1 PD-C PD-C-1 יכולים לשתוף קבצים באמצעות Bluetooth או לשלוח אותם על פנוי Wi-Fi באמצעות יישום של צד שלישי. השימוש בישומים של צד שלישי נתון לשיקול דעתו ובאחריותו של המשתמש. ישומים של צד שלישי עשויים להכין שינויים בתנאים העסקים או בתוצאות הרכישה. **Hilti** לא תישא אחריות ולא תספק תמיכה ליישומים של צד שלישי.

הערה

משתמשים של מחשבי Mac עם מערכת ההפעלה Mac OS X 10.5 או גרסה מאוחרת יותר יכולים לצורך תמייהה בהעברת קבצים מה-PD-C Mac למחשב Mac להוריד את תוכנת ההעברה הרשמית של .[Android](https://www.android.com/filetransfer/). ראה/[Android](https://www.android.com/filetransfer/)

התקן היעד של חיבור ה-Bluetooth צריך להיות כבר מצומד לצורך העברת הקבצים.

הערה

התקני Android רבים כמו גם מחשבים עם גרסת Windows 10.5 או גרסה מאוחרת יותר יכולים לבצע בהצלחה בבדיקות צימוד עם המחשב. עם זאת, **Hilti** איננו יכול לעורב שכלי שצימוד עם כל התקן יצליח. Apple אינה מתירה למד הטוווח להעביר קבצים להתקן Apple באמצעות תקשורת Bluetooth.

אפשר ליצא פרויקטים בתבניות PDF או CSV; תוצאות הפונקציות 'Measure from picture' ו-'Draw in Picture' מוצאות כקובץ JPG. אפשר ליצא את הקבצים גם לזכרון הבדיקה של מד הטוווח. ממש אפשר ליצא את הקבצים למחשב אישי באמצעות כבל מיקרו USB.

4.3.6 קבצים שיוצאו לדיןון הבדיקה

הערה

תוצאות שאינן נחותות עוד יש להקפיד למחוק באופן סדר, כדי שה-PD-C ו-PD-CS לא יגעו לגבולות קיבולת הדיןון שלהם 2 GB.

גם אם גודלים של קובצי התוצאות משתנה, לדוגמה כאשר ישנן תמונות בעירות, שימוש וגיל מספק בממוצע לשמירה של כ-3000 תוצאות.

אי אפשר להשתמש בתוצאות השמורות בזיכרון הבדיקה מתוך ה-C-PD וה-CS-PD: התוכנה הנוכחית אינה מאפשרת לנצל את הקבצים השמורים בזיכרון הבדיקה, לעורוך או למחוק אותם. ברגע שה-C-PD מחובר למחשב באמצעות כבל מיקרו USB, ספריית האב של ה-C-PD צריכה להופיע במערכת הקבצים של Windows תחת "המחשב שלי". שם הוא `oatc_export`. ספרייה זו מכילה ספריות משנה עבור הנתונים שייצאו, והיא מסודרת בסדר כרונולוגי לפי תאריך ושעה של הייצוא וכן שם הפרויקט או שם התוצאה.

- ◀ העתק את התקיות או הקבצים שבספרייה `oatc_export` אל המחשב שלך.

4.4 מדידת נקודת ומדידת תחום

אפשר לבדוק את המרחק כמדד נקודת נקודת או כמדד תחום.

מדד נקודת נקודת
במדד נקודת נקודת נמדד המרחק לנקודת ביעד.

מדד תחום

במדד תחום נמדד מרחק מינימום או מקסימום לכל תחום הכנוי. מדידת התחום משמשת להעברת מרחקים או אורכים נתוניים וכן למדד מרחקים קשים למידיה, כגון בפינות, קצוות או גומחות. במהלך מדידת תחום, המרחק מוצג בזמן אמת כמעט. מהירות התצוגה תלולה בכושר ההחזרה של פניהם השטח של היעד.

לאחר סיום המדידה יוצג דף התוצאות בתיקיית הפרויקט.

4.5 טווח הגעה של המידידה

בהירות הסביבה משפיעה על טווח הגעה של המידידה.

4.5.1 הגדלת טווחי הגעה

מדדנות בחשכה, בשעת דמדומים ועל ידיים מוצללים או כאשר המכשיר מוצל מובילות בדרך כלל להארכת טווח הגעה. שימוש במאיר המידידה 72 PDA או בחזובה מגדייל במרחקים גדולים את הסבירות לקבל תוצאה מדידה, לאחר שהוא מקל על קליטת הקרכבים המוחדרות. גם השימוש בלוחות מטרה מאפשר להגדיל את טווח הגעה של המכשיר (← עמוד 55).

4.5.2 טווחי הגעה פחותים

מדדנות בסביבה שיש בה אור חזק, לדוגמה תחת אור שמש או תחת תאורת פנסים חזקה, עשויות לזרע את הטווח. מדידה על משטחי מט, משטחים יroxים, כחולים או שחורים עשויה גם היא לזרע את טווח הגעה כמו גם פני שטח רטובים או מבריקים. טווח הגעה עשוי להתצרר או התוצאה עשויה להיות שגوية כאשר בנתיב הלידר נמצאים אובייקטים וכן במידה דרך זכוכית.

4.6 דיווי יעד המידידה בסיום המצלמה

1. גע בסמל "מצלמה".
2. קלוט את היעד באמצעות המצלמה והבא את צלב המיקוד מעל ליעד.
3. הפעל מדידה.
4. גע שוב בסמל "מצלמה" לאחר שסיימת להיעדר במכשיר.

5 הכנה והגדרות

5.1 טעינת הסוללה המובנית

- ◀ טען לגמרי את הסוללה המובנית לפני השימוש הראשון במכשיר (ראה ← עמוד 50).

5.2 הפעלה/כיבוי, המתנה ושחרור נעליה

5.2.1 הפעלה

1. לחץ לחיצה קצרה על מותג הפעלה/כיבוי.
 - ▷ כעבור 15 עד 20 שניות המוצר יהיה מוכן לפעולה. הצג הנעל יזג.
2. כדי לשחרר את הצג החלק את סמל המבעול ימינה מעבר לקצה הצג.
 - ▷ תוצאות המדידה של הפרויקט הבוכחי יוצגו, ותוכל לבחור פונקציות באמצעות ⌂.

5.2.2 המתנה או כיבוי

לאחר שימוש וגיל באפשרות או לכבות את מד טווח המרחק או להוביל אותו במצב המתנה (Standby). המכשיר עבר אוטומטית במצב המתנה לאחר זמן מה ללא שימוש. כאשר הסוללה טעונה למגררי-Bluetooth מושבת המכשיר יכול להישאר במצב המתנה בין שבוע לחודש ימים לפחות שהוא צורך לטעון אותו שוב. لكن בשימוש יומי-יומי מומלץ להשתמש במצב המתנה.

5.2.3 הפעלת מצב המתנה

- ◀ לחץ לחיצה קצרה על מותג הפעלה/כיבוי.
- ▷ הציגוגה תכבה, והמכשיר יימצא במצב המתנה.

הערה

כאשר מד הטווח נמצא במצב המתנה, אפשר להפעיל אותו מחדש באמצעות כל אחד מרבעת הלחצנים.

5.2.4 שחרור נעלית המכשיר

הערה

עבור זמן מה לא תפעול המכשיר הוא יעבור במצב מנוחה והציג יינעל.

1. לחץ לחיצה קצרה על אחד מרבעת לחצני המכשיר.
 - ▷ הצג יופעל מחדש וסמל המבעול יזג.
2. כדי לשחרר את הצג החלק את סמל המבעול ימינה מעבר לקצה הצג.
 - ▷ המכשיר משוחרר.

הערה

לחיצה על אחד משלשות לחצבי המדידה תוביל אותך לשירות לפונקציה 'ישיר'.

5.2.5 כיבוי

הערה

עליך לכבות את המכשיר רק אם לא תזדקק לו ביום הבאים או כאשר המכשיר אמר לחדיק מעמד זמן רב לפני הטעינה הבאה.

1. לחץ לחיצה ממושכת על מותג הפעלה/כיבוי.
 2. בחר בתפריט 'כיבוי'.
 3. אשר באמצעות 'OK'.
- ▷ המכשיר ירטוט פעמיים ואז יכבה.

5.3 כוֹל חִיּוֹן הַשִּׁיפּוּעַ

הערה



כיוֹל סְדֵר שֶׁל חִיּוֹן הַשִּׁיפּוּעַ תָּורֵם לְרַמֶת דִּיקָן גְּבוּהָה. ذָה נְכוֹן בָּמִיחָד לְמִדְידֹת עֲקִיפּוֹת, שַׁהְתוֹצֵאָה שְׁלָהָן מִבּוֹסֵסָת עַל הַדִּיקָן שֶׁל חִיּוֹן הַשִּׁיפּוּעַ.
(חִיּוֹן הַשִּׁיפּוּעַ אַיִן מִשְׁפִּיעַ עַל הַדִּיקָן שֶׁל הַלִּיזֶר בְּמִדְידֹת עֲקִיפּוֹת.)

1. בתפריט '**פונקציות**' בחר את האפשרות '**הגדרות**' ו-'**כוכון חישון השיפוע**'.
2. הנח את המקשריר על משטח מישורי כשהציג פונה כלפי מעלה.
3. לחץ על לחץן המדידה.
4. סובב את המקשריר בכיוון המנוגד, בלי להרים אותו מהמשטח שעליו הוא מונח.
5. לחץ על לחץן המדידה.
▷ חישון השיפוע מכויל.

5.4 התחברות באמצעות Bluetooth

הערה



בפעם הראשונה שאתה מחבר את מד הטווח באמצעות Bluetooth להתקן אחר, ודא ש-**ה-Bluetooth** פועל בהתקן الآخر ושהתקן זה נמצא במצב גלי להתקנים אחרים. לא שני השלבים האלה מד הטווח לא יכול להתחבר להתקן الآخر.

1. פתח את הגדרות המקשריר בדף הפתיחה.
2. באזרע "הרשאות אלחוטיות" בחר באפשרות "הפעל Bluetooth".
3. בחר "עוד...".
▷ המערכת תחפש התקן Bluetooth מתאים.
4. ודא שבהגדרות של התקן שברצונך לחבר מציב גלי להתקנים אחרים פועל או שיש אישור להתחבר להתקנים אחרים. מידע נוספת תמצא בטייעוד של אותו התקן.
5. אם לא נמצא אף התקן Bluetooth, בחר "חפש התקנים".
6. בחר תחת "התקנים זמינים" את התקן המיועד לצימוד ברגע שהוא מוצג.
7. אשר את הצימוד בלחיצה על "כן" או "צימוד".

הערה



אם ברצונך להאריך את משך הפעולה של סוללה הליתיום-יון, בטל את ה-**ה-Bluetooth** לאחר העברת הקבצים.

5.5 התחברות באמצעות Wi-Fi

PD-CS

1. פתח את הגדרות המערכת.
2. הפעיל את Wi-Fi באזרע **אלחות ורשנות**.
3. בחר את הרשות המבוקשת.

5.6 הגדרות עבור אפליקציית המדידה

תיאור	הגדרה
<p>בחרית יחידת האורך עבור מדידת המרחק</p> <p>עבור יפן: עבור מכשירים הרשומים ביפן רק מידות עשרוניות דמינות.</p> <p>הערה</p> <p>לאחר בחרית יחידת מדידה אחרת, גם תוכנות המדידה השמרות יומרו ליחידת המדידה החדשה.</p>	' יחידת אורך '

הגדרה	תיאור
' יחידת שיפוע'	בחירה יחידת האורך עבור השיפוע
' צליל חיוני'	כיבוי והפעלה של צליל החיווי
' Vibration	כיבוי והפעלה של הרטט
' כוונון חיישן השיפוע'	התחלת תהליך הכוון
' תצלום יעד'	כיבוי והפעלה של צילום תМОנות יעד. תМОנות היעד נשמרת ומוצגת ביחס עם התוצאה בראשית התוצאות. הגדרת ברירת מחדל: מופעל
הגדרת ברירת מחדל עבור מצלמת היעד במדידה ישירה (' תצלום יעד במדידה ישירה ')	כבה או הפעלת השימוש במצלמת היעד כברירת מחדל במידדות ישירות (מידדות בודדות). במצב "כבוי" אפשר להפעיל את מצלמת היעד לפי הצורך. במצב "מופעל" מצלמת היעד תופעל אוטומטית תמיד בעת ההכנה לממדידה ישירה. הגדרת ברירת מחדל: כבוי
הגדרת ברירת מחדל עבור מצלמת יעד בעבודה עם פונקציות משולבות (' תצלום יעד במדידה עקיפה)	בטל או הפעלת השימוש במצלמת היעד כברירת מחדל בכל המדידות מלבד "ישירה". במצב "כבוי" אפשר במקרה הצורך להפעיל את מצלמת היעד, כדי להקל על מיקום נקודת הליזר. במצב "מופעל" מצלמת היעד תופעל אוטומטית תמיד בעת ההכנה לממדידה. הגדרת ברירת מחדל: כבוי
' הגדרות יצורן'	במצב "מופעל" הגדרות ברירת המחדל יופעלו עבור כל ההגדרות של אפליקציית הממדידה.
' הגדרות יצורן'	במצב "מופעל" הגדרות ברירת המחדל יופעלו עבור כל ההגדרות של אפליקציית הממדידה.
' PD-C project export'	הוסף או הסר את הלוגו של Hilti בפינה השמאלית עליונה של דוח ה-PDF.
Please choose valid ' image type (jpg/png)	הגדרת ברירת מחדל: מוצג הוסף או בטל את כרטיס הביקור של המסתמש עבור דוח PDF. לפבי כן יש לצלם את כרטיס הביקור באמצעות המכשיר. הגדרת ברירת מחדל: ללא

6. עבודה עם אפליקציית הממדידה

6.1 מדידה ישירה באמצעות הפונקציה 'ישירה'

6.1.1 מדידת מרחק בודדת, ישירה

1. בחר את הפרויקט שעבורו תרצה לבצע את הממדידה.
2. בתפריט '**פונקציות**' בחר את האפשרות '**ישיר**'.
 - ▷ הליזר יופעל, ועל הצג יופיע סמל לחץ הממדידה.
3. מוקם את בסיס המכשיר בנקודת ההתחלה של הממדידה. ודא תוך כך שהמכשיר ממוקם בצורה יציבה.
4. כוון את נקודת הליזר לנקודת הקצה של הממדידה, תוך שאתה שומר על מיקום יציב של המכשיר.
5. גע בסמל לחץ הממדידה או לחץ על לחץ הממדידה.
 - ▷ הממדידה תסתיים, והתוצאה תוצג.
 - ▷ לחיצה על סמל המידע תציג מידע נוסף על תוצאה הממדידה.

הערה

אם תרצה תוכל להוסיף תצלום לממדידה, לשם כך גע בסמל המצלמה או הגדד את סרגל התוצאות שמאליה כדי לבדוק את תצלום היעד של הממדידה.



6.1.2 מיצב מדידה רציפה

כדי להפעיל מיצב זה יש ללחוץ לחיצה ממושכת על לחץ המדידה; מיצב זה ייעיל במיוחד בשימוש במדנקים 'Minimal', 'Maximal', 'Vertical', 'Horizontal'.

6.1.3 הפעלת מיצב מדידה רציפה

1. כדי להפעיל את מיצב המדידה הרציפה לחץ לפחות כ-2 שניות רצופות על אחד מלחצבי המדידה.
 - ▷ ברגע שהמדידה הרציפה הופעלה ישמע צליל חיוי 2 עד 3 פעמים בשנייה, ובמרכז הצג יוצג ברציפות המרחק.
2. כדי לבטל את המדידה הרציפה גע במרחב המוצג במרכז הצג או לחץ על אחד מלחצבי המדידה.
 - ▷ צליל החיוי יושתק ותוצאת המדידה התקינה האחורה תוזג.



באפשרות גם לכבות את צליל החיוי בהגדירות של אפליקציית המדידה.

6.2 מדידה ותיעוד של מרחקים בתצלום באמצעות הפונקציה 'Picture'

שתי פונקציות מאפשרות מדידה ותיעוד של מרחקים ישירות בתצלום שצולם באמצעות המצלמה המובנית.

- **דיזרי מרחקים בתצלומים ('Measure from picture')**
- **שרטוט בתצלומים ('Draw in picture')**

המצלמה הקדמית המובנית מתאימה היטב לצילוי נקודת הלידר למרחק גדול, ולכן שדה הראייה שלה צר. לפיכך כדי לצלם אזורים רחבים יותר יש להגדיל את המרחק לאובייקט המיועד לצלום. למצלמת התיעוד המובנית (PD-CS) יש שדה ראייה נרחב. מצלמה זו תופעל רק בפונקציה **שרטוט בתמונה**.

6.2.1 'Measure from picture'

פונקציה זו מספקת ערכיהם מקורבים עבור מרחקים שאזותם אתה יכול לשרטט בתמונה לאורך אלמנטים לבחירתך. קווים אלה חיברים להימצא על מישור אחד ישר (דו-ממדי) לדוגמה קיר, חזית של בניין או תקרה.

דוגמאות לשימוש בפונקציה 'Measure from picture':

- הערצת מרחק מקוvert, לדוגמה כדי לזהות את גובה הסולם המינימלי הדורש ביחס לגובה הקיר, כך שאפשר יהיה להציגו לקצה הקיר
 - הערצת המקום שנוצרה להתקנת שלט על חזית המבנה
- כאשר קרו הלידר מכוכנת בזווית ישרה (90°) למשטח מואZN, רמת הדיוק של ההערכתה תהיה $1\% \pm 2\%$. המגבלה של פונקציה זו בהשוואה לפונקציה הבאה, '**Draw in picture**', היא שבמדידה ובצלום יש להKEEP על זווית ישרה מדויקת. המכשיר אינו מסוגל לזהות אם דזיות הצלום נכונה או אם המשטח המצלום אכן מואZN. במקרה זה הסטייה בין העריכה למדידה בפועל תהיה גדולה.
- בזמן שאתה משרטט ומאריך קו, אתה רואה את המרחק שמחושב אוטומטית מהתמונה.

6.2.1.1 מדידת מרחק בתצלומים

1. בתפריט 'Functions' בחר את האפשרות 'Picture'-> 'Measure from picture'.
 2. הבא את המכשיר לזווית ישרה ביחס למשטח שאליו אתה מכון.
 3. לחץ פעם אחת על לחץ המדידה או גע בצלב המיקוד פעמיים.
 4. גע בסמל העיפרון.
- ▷ סמל הקו והסמל להערת טקסט יופיעו וכעבור כמה שניות יוסתרו.



אם הסמלים מוסתרים, גע בתמונה כדי להציג אותם שוב.



5. גע בסמל הקו.

▷ קו יוצג על התמונה.

6. הzd את נקודת התחלה ונקודת הסיום של הקטע

בערך אל המיקום הדורש.

הערה



נקודת התחלה ונקודת הסיום של הקטע חייבות להיות על אותו משטח מישורי. אם התמונה מכילה אזורים שאינם שייכים לאותו משטח מישורי, קביעת נקודות הקצה באזורי אלה יגרום לסתיה משמעותית בערכיהם.

7. גע בנקודות הקצה ובלי לשחרר אותן הגדל את הקטע, שחרר את האצבעות רק לאחר הגעה למיקום המדויק.

▷ האורך שנמדד של הקו שנקבע בתמונה יוצג.

6.2.1.2 'Measure from picture' – פונקציות נוספות

- ◀ הוספה קטעי מרחוק: בחר למטה משמאלי הסמל "קטע מרוחק חדש".
- ◀ הארכה או מחיקה של קטע מרוחק: גע בקטע המרוחק על הצג.
- ◀شرط טט: כאשר ישנו 3 קטעי מרוחק או יותר חバー את הקטע האחרון עם הראשון.

6.2.2 'Draw in picture' ('Draw in picture') – 'Picture'

1. בתפריט 'פונקציות' בחר את האפשרות 'Picture'-1.
2. צלם את האזור שבו ברצונך לתעד את המרחוקים שנמדדוו.

הערה



במקום תצלומים תוכל להשתמש גם בתמונה מהגלארייה.

3. גע בסימן ה"ו"י" אם ברצונך להשתמש בתצלום.

▷ התמונה נבחרה וכעת אפשר לעורך אותה.

הערה



תוכל לחזור על השלבים הבאים בכל עת לאחר שתפתח את התמונה בתיקיית הפרויקט.

4. גע בסמל העיפרון.

▷ סמל הקו והסמל להערת טקסט יופיעו וכעבור כמה שבויות יוסתרו.

הערה



אם הסמלים מוסתרים, גע בתמונה כדי להציג אותם שוב.

5. גע בסמל הקו.

6. בחר את המקור של נתון המרחוק: או על ידי מדידה באמצעות 'Direct' או על ידי בחירת מדידה שומרה באמצעות 'Data' או בהזנה של הערך באמצעות 'דזינה מסכנית'.

▷ קו עם מידות יוצג על התמונה.

7. הzd את נקודת התחלה ונקודת הסיום של הקטע בערך אל המיקום הדורש.

8. גע בנקודות הקצה ובלי לשחרר אותן הגדל את הקטע, שחרר את האצבעות רק לאחר הגעה למיקום המדויק.

▷ כעת אתה יכול להתבונן בתמונה ולעורך אותה.



9. כדי לשמר את התמונה עלי' ליצא אותה כקובץ **JPG**.

6.2.2.1 **תיעוד המרחקים שנמדדו בתצלומים – פונקציות נוספות**

- ◀ עריכת תוצאות שמורות: לחץ למטה שמאל על סמל העיפרון.
- ◀ הוספת טקסט תיאור: לחץ למטה במרכז על סמל הטקסט.
- ◀ ייצוא התוצאה כקובץ JPG: גע למטה מימין בסמל.
- ◀ הוספה קטע מרחק לתמונה: גע למטה שמאל בסמל.
- ◀ הוספה תיבת טקסט לתמונה: גע למטה מימין בסמל.

6.3 **חישוב שטחים ונפחים**

6.3.1 **הfonקציות 'שטח ונפח'**

בעדות הסמלים שעל צג המגע אפשר לחשב ישרות שטחים מלכניים ומשולשים וכן נפחים בצורת תיבה וגליל.

6.3.2 **חישוב שטח מלכני**

1. בחר בתפריט **'Functions'** את האפשרות **'שטח ונפח'-1-'Rectangle'**.
2. מדוד את הרוחב.
3. מדוד את הגובה.
- ▷ השטח יוצג.

6.3.3 **חישוב שטח מרובע – פונקציות נוספות**

1. בחר את הסמל עבור פונקציית הסיכון לאחר שהפקת את התוצאה.
2. מדוד שטחים נוספים.
 - ▷ השטח הכללי יוצג.
3. קרא את התוצאה.

6.3.4 **חישובים נפחים בצורת תיבה**

1. בחר בתפריט **'fonkציות'** את האפשרות **'שטח ונפח'-1-'Volume Room'**.
2. מדוד את האורך.
3. מדוד את הרוחב.
4. מדוד את הגובה.
- ▷ הנפח יוצג.

6.3.5 **חישוב נפח גליל**

1. בתפריט **'fonkציות'** בחר את האפשרות **'שטח ונפח'-1-'Volume Cylinder'**.
2. מדוד את האורך.
3. מדוד את הקוטר.
- ▷ הנפח יוצג.

6.4.1 על מדידות עקיפות

הערה



רמת הדיק של מדידות באמצעות הפונקציות '**עקיף**' ו-'**פיתגורס**' תליה בעיקר בכך שנקודות הייחוס תישאר ללא שינוי. קשה להגעה למסב זה כאשר המכשיר מוחזק בלבד, ללא נקודות משען. אפשר להשיג רמת דיק גבוהה כאשר מציבים את המכשיר על משטח יציב, כגון על שולחן או רצפה. אם אין משטח יציב נגיש, מומלץ לתמוך את המכשיר במרכז הגוף, כגון על חגורה.

הפתרון הטוב ביותר הוא תמיד להעמיד את מאריך המדידה הקצר על משטח חלק ומוצק. הדריך הטובה ביותר להגבר את מידת הדיק היא לשמר על חוד מאריך המדידה בדיק באותה נקודות ייחוס במשך כל המדידות.

מדידות עקיפות מסייעות במדידת מרחוקים מסוימים שאין אפשר למדוד אותם ישירות. ישנן שיטות שונות למדוד מרחוקים בדרך עקיפה. תצוגה גרפית תציג לך בכל מדידה חלקית איזה מרחוק יש למדוד. ברגע שמדדת את כל המרחוקים הדרושים והוצאות השיפוע, התוצאה תחשוב ותוצג.

באופן עקרוני החישובים המבוססים על תוצאות של מדידות עקיפות אינם מדויקים כמו מדידות ישירות.

6.4.1.1 הנחיות למדידות עקיפות

- ◀ שים לב להנחיות הבאות, כדי שתשיג את התוצאות הטובות ביותר.
- ◀ שים לב לגאומטריה נכונה (כגון דווית ישירה ויחסים המשולש).
- ◀ כוונן במדויק לפינות כאשר כל נקודות המדידה נמצאות במישור אחד וכך אתה מודד קרוב יותר לאובייקט ולא מרחק גדול.
- ◀ במדידה עם שיפוע אין להטות את המכשיר הצד, מאחר שاذ תוצאות המדידה יהיו שגויות. כאשר המכשיר נוטה הצד תונך אזהרה ולא תתאפשר מדידה.
- ◀ בכל המדידות העקיפות הקפד לבצע את כל המדידות בתוך אותו מישור אבci או אופקי.
- ◀ עברו הפונקציות '**עקיף**' ו-'**פיתגורס**' השתמש בכל המדידות בדיק באותה נקודות מגע ובאותו ציר.

6.4.1.2 'עקיף' לעומת 'פיתגורס'

במבט ראשון נראה שכמעט שאין הבדל בין שתי הפונקציות. ההבדל העיקרי ביןיהן הוא שקבוצת הפונקציות '**עקיף**' מסתיעת בחישון השיפוע האנכי של המכשיר, והמדידות חיותה להיערך תמיד באותו מישור אבci. קבוצת הפונקציות '**פיתגורס**' לעומת זאת, אינה משתמשת בחישון השיפוע ולכן היא מתירה מדידות בכיוונים בעלי כל שיפוע שתבחר.

באמצעות קבוצת הפונקציות '**עקיף**' אפשר, לדוגמה, לזהות את גובהו של קיר על ידי מדידה של שתי נקודות בלבד: כלפי מטה, להיכן שהרכפה והקיר נפגשים ובגובה אבci מדויקת למעלה, היכן שהkir והתקלה נפגשים.

המכשיר מסוגל לחשב את הגובה بصورة עקיפה, מאחר שהוא מכיר את הדווית של שתי המדידות. באמצעות פונקציות פיתגורס אפשר להשיג את אותה התוצאה. מאחר שחישון השיפוע אינו פעיל, יש לבצע לפחות מדידה אבci מדויקת אחת לאובייקט הנבדק.

היתרון במדידות באמצעות קבוצת הפונקציות '**עקיף**' הוא שכן מושגות את התוצאה בפחות שלבים. היתרון במדידות באמצעות קבוצת הפונקציות '**פיתגורס**' הוא שכן מאפשרות מדידה עקיפה גם של אורךים אופקיים ואלכסוניים, כל עוד אפשר לבצע לפחות מדידה אבci מדויקת אחת בקטע המרחק.

6.4.2 'עקיף', 'אבci'

פונקציה זו מודדת את המרחק האנכי בין שתי נקודות על מבנה אבci מדויק.

יא מתחילה במיוחד למסבים שבהם יש צורך למדוד מרחק אבci לאורק קיר כאשר גישה ישירה (לדוגמה גובה קומה של מבנה).

6.4.3 מדידה עקיפה של מרחק אופקי

1. בתפריט 'פונקציות' בחר את האפשרות '**עקיף**' ו-'**Horizontal**'.

2. מודד את המרחק לאנק של מבנה בעל זווית 90° , בזווית כלשהי אולם בתוך אותו מישור אנכי שבו נמצא המרחק שברצונך למדוד.

▷ התוצאה תוצג.



כיל באופן סדר את חישון השיפוע (\leftarrow עמוד 69). כך תבטיח רמת דיק גבואה במדידה.

6.4.4 מדידה עקיפה של מרחק אנכי

1. בתפריט 'פונקציות' בחר את האפשרות 'עקיף' ו-'אנכי'.

2. מקם את המכשיר כך שהציג יפנה כלפי מעלה או מטה, והקפד שהמכשיר לא יהיה לאחד הצדדים.



וזא שמקום הייחוס נותר ללא שינוי במהלך המדידה כולה. מומלץ להיעזר במארך המדידה הקצר. פונקציה עקיפה זו משתמש בחישון הדיזiot שעובד רק עם הטיה אנכית. הציג יכול לפנות כלפי מעלה או מטה, אבל לא להיות מסובב שמאליה או ימינה. בשיפוע צדי של יותר מ- 5° תיעלם תצוגת השיפוע מהציג ומדידת הדיזiot לא תתאפשר עוד.

3. מודד את המרחק לנקודת הקצה העליונה.

4. הטה את המכשיר אנכית בכיוון לנקודת הקצה התחתונה, בלי לשנות את מיקום הייחוס.

5. מודד את המרחק לנקודת הקצה התחתונה.

▷ התוצאה תוצג.



כיל באופן סדר את חישון השיפוע (\leftarrow עמוד 69). כך תבטיח רמת דיק גבואה במדידה.

6.4.5 מדידה עקיפה של מרחק אופקי מעלה לראש

1. בתפריט 'פונקציות' בחר את האפשרות 'עקיף' ו-'מעל לראש'.

2. מקם את המכשיר כך שהציג יפנה כלפי מעלה או מטה, והקפד שהמכשיר לא יהיה לאחד הצדדים.



וזא שמקום הייחוס נותר ללא שינוי במהלך המדידה כולה. מומלץ להיעזר במארך המדידה הקצר. פונקציה עקיפה זו משתמש בחישון הדיזiot שעובד רק עם הטיה אנכית. הציג יכול לפנות כלפי מעלה או מטה, אבל לא להיות מסובב שמאליה או ימינה. בשיפוע צדי של יותר מ- 5° תיעלם תצוגת השיפוע מהציג ומדידת הדיזiot לא תתאפשר עוד.

3. מודד את המרחק לנקודת הקצה הראשונה.

4. הטה את המכשיר אנכית בכיוון לנקודת הקצה השנייה, בלי לשנות את נקודת הייחוס.

5. מודד את המרחק.

▷ התוצאה תוצג.



כיל באופן סדר את חישון השיפוע (\leftarrow עמוד 69). כך תבטיח רמת דיק גבואה במדידה.

6.4.6 'עקיף', 'לא מחייב'

פונקציה זו מודדת את המרחק לנקודת הקצה של האובייקט שכמעט ואינה מחזירה או, כמו לדוגמה קצה של מבוק או צמרת עץ.

היא מתאימה לחישוב המרחק כאשר נקודת היעד אינה מחזירה או.

6.4.7 מדידה עקיפה של גובה אובייקט באמצעות נקודת יעד ברוחה אחת

1. מוקם את המכשיר כך שהצג יפנה כלפי מעלה או מטה, והקפד שהמכשיר לא ייטה לאחד הצדדים.

הערה



ודא שמקום הייחוס נותר ללא שינוי במהלך המדידה כולה. מומלץ להיעדר במאיריך המדידה הקצר. פונקציה עקיפה זו משתמש בחישון הדזות שעובך רק עם הטיה אנכית. הצג יכול לפנות כלפי מעלה או מטה, אבל לא להיות מסובב שמאליה או ימינה. בשיפוע צדי של יותר מ- 5° תיעלם תצוגת השיפוע מהצג ומדידת הדזות לא תתאפשר עוד.

2. מדוד את המרחק לנקודת הקצה התחתונה.

3. הטה את המכשיר אנכית בכיוון לנקודת הקצה העליונה, בלי לשנות את נקודת הייחוס. הפעל את מצלמת היעד אם נקודת הקצה שאליה אתה מכoon אינה מחדירה או.

4. הפעל את המדידה לנקודת הקצה.

▷ המכשיר ימדוד את הדזות לנקודת הקצה, והtoutזאה תוצג.

הערה



כיל באופן סדיר את חישון השיפוע (\leftarrow עמוד 66). כך תבטיח רמת דיק גבואה במידידה.

6.4.8 מביבום, מקסימום והפרש ביןיהם בתחום מסוים

6.4.8.1 מיב'/מקס'/דלתא

פונקציה זו מפעילה את המדידה הרציפה. אם, למשל, תחליק את המכשיר במהלך המדידה לאורך משטח ייחוס חלק או תסובב אותו סביבו נקודת ייחוס, תוכל למדוד את המרחק המקסימלי והמינימלי מאובייקט היחוס כמו גם את ההפרש בין המביבום למаксימום.

6.4.8.2 מדידת ההפרש בין המרחק המינימלי למקסימלי בתחום מסוים

1. הפעל את הפונקציה 'מיב'/מקס'/דלתא'.

2. מוקם את המכשיר.

3. לחוץ על לחוץ המדידה.

▷ מדידה רציפה תתחילה.

4. הגד את המכשיר לאורך קו היחוס או שטח היחוס.

5. לחוץ שוב על לחוץ המדידה.

▷ המדידה תסתיים, והtoutזאה תוצג.

6.5 מדידות עם פונקציות פיתגורס

6.5.1 קבוצת פונקציות 'פיתגורס'

הערה



כדי לקבל את התוצאות המדוייקות ביותר באמצעות הפונקציות 'עקיף' ו-'פיתגורס' יש להשתמש בעבר כל המדידות בדיק באותה נקודת מגע ובאותו ציר מרכזי.

הערה



פונקציות פיתגורס ייעילות במיוחד במידודות עקיפות של אורכים אופקיים ואנכיים שאינן אפשר למדוד אותם באמצעות הפונקציות מהקובוצה 'עקיף'.

6.5.2 פונקציה 'פיתגורס I'

פונקציה זו מודדת את האורך של קטע מדידה מסוים באמצעות עקיף באמצעות מדידה של 90° לנקודת התחלה של קטע המדידה. זו פונקציה שימושית כשייש צורך לקבוע אורך של מרחקים אופקיים.

6.5.3 מדידה באמצעות הפונקציה 'פיתגורס I'

1. מדוד מנקודה בדזוזית ישירה את המרחק לנקודת הקצה הקרה יתור של הקטע.

הערה

במדידה בדזוזית ישירה חשוב לשמור על זווית מדויקת של 90° .

ודא שמקום הייחוס נותר ללא שינוי במהלך המדידה כולה. מומלץ להיעדר במאיריך המדידה קצר. לאחר שפונקציות פיתגורס אינן דקוקות לחישון השיפוע, אפשר להטוט את המכשיר לכל כיוון.

2. מדוד את המרחק לנקודות הקצה הרוחקה יותר בקטע.

▷ התוצאה תוצג.

6.5.4 הפונקציה 'פיתגורס II'

פונקציה זו מודדת את האורך של קטע מרחק מסוים באופן עקיף באמצעות מדידה ב- 90° לקטע מרחק זה.

6.5.5 מדידה באמצעות הפונקציה 'פיתגורס III'

1. מדוד את המרחק לנקודות הקצה הראשונה בקטע.

הערה

ודא שמקום הייחוס נותר ללא שינוי במהלך המדידה כולה. מומלץ להיעדר במאיריך המדידה קצר. לאחר שפונקציות פיתגורס אינן דקוקות לחישון השיפוע, אפשר להטוט את המכשיר לכל כיוון.

2. מדוד מנקודה בדזוזית ישירה מרחק כלשהו בקטע. שים לב כי נקודת זו חייבת להימצא על אותו הקו של שתי נקודות הקצה של הקטע.

הערה

במדידה בדזוזית ישירה חשוב לשמור על זווית מדויקת של 90° .

3. מדוד את המרחק לנקודות הקצה האחרת בקטע.

▷ התוצאה תוצג.

6.5.6 הפונקציה 'פיתגורס III'

פונקציה זו מודדת את האורך של קטע מרחק מסוים באופן עקיף באמצעות מדידה ב- 90° לקו מאיריך של קטע מרחק זה.

6.5.7 מדידה באמצעות הפונקציה 'פיתגורס III'

1. מדוד מנקודה זווית ישירה את המרחק לנקודת הנמצאת בהארכת הקו של הקטע.

הערה

במדידה בדזוזית ישירה חשוב לשמור על זווית מדויקת של 90° .

ודא שמקום הייחוס נותר ללא שינוי במהלך המדידה כולה. מומלץ להיעדר במאיריך המדידה קצר. לאחר שפונקציות פיתגורס אינן דקוקות לחישון השיפוע, אפשר להטוט את המכשיר לכל כיוון.

2. מדוד את המרחק לנקודות הקצה הראשונה בקטע.

3. מדוד את המרחק לנקודות הקצה האחרת בקטע.

▷ התוצאה תוצג.

6.6 מדידות עם פונקציות טרפז

6.6.1 קבועת הפונקציות 'טרפז'

כדי למדוד משטח משופע יש לבצע 3 מדידות ייחוס.

הערה



מדידות באמצעות הפונקציות 'עקב', 'פיתגורס' ו-'טרפז' מושגות בדרך כלל תוצאות מדוקימות הרבה פחות מאשר מדידה ישירה. זה קורה בגלל השינוי במיקום שתרחש בשימוש ידני (לא חצובה יציבה ולא נקודת מגע ונקודת יעד מסומנות).

6.6.2 הפונקציה 'טרפז II'

פונקציה זו מודדת באמצעות 3 מדידות ייחוס את האורך של משטח משופע.

6.6.3 מדידה באמצעות הפונקציה 'טרפז I'

1. מדוד מבסיס על משטח מישורי ליעד בקצה העליון של המשטח המשופע.

הערה



המדידה הראשונה והשלישית צרכיות להצלב עם הקטע שנמדד במדידה השנייה בזווית של 90°. שימוש במדנק האופקי והאנכי מוגבר את רמת הדיק במדידה.

2. מדוד את המרחק האופקי בין נקודות הייחוס המדוקינות של המדידה הראשונה והשלישית.

3. מדוד מבסיס באותו משטח מישורי כמו במדידה הראשונה אל יעד בקצה התיכון של המשטח המשופע.
▷ התוצאה תוצג.

6.6.4 הפונקציה 'טרפז III'

פונקציה זו מודדת באמצעות 2 מדידות ייחוס את האורך של משטח משופע.

6.6.5 מדידה באמצעות הפונקציה 'טרפז III'

1. מדוד מבסיס על משטח מישורי ליעד בקצה העליון של המשטח המשופע.

הערה



ואו שמקום הייחוס כותר לא שיוני במהלך המדידה כולה. מומלץ להיעדר במאירך המדידה הקצר.

2. הטה את המכשיר אנטית לפני מטה, וכoon לנקודת הקצה התיכון.

3. מדוד לקצה התיכון של המשטח המשופע.
▷ התוצאה תוצג.

7 טיפול ותחזוקה

7.1 ניקוי

מכשיר מיועד לעובדה בתנאים של אתר בנייה. ההגנה מפני חידרת אבק ונתזים מים תואמת את דירוג הגינה IP54.

לכלוך על CISCO הזכוכית של עדשת המצלמה ושל חלונית יציאת הליזר עשוי לפגוע באמיניות תוצאות המדידה ולפגום בבהירותות של תמונות המדידה.

◀ כאשר המכשיר מולכֵל יש לנוקות אותו במטלית רכה, רטובה קלות במים.

◀ הקפֶד במיוחד בניקיון של CISCO הזכוכית של עדשת המצלמה ושל חלונית יציאת הליזר.

◀ לפחות ניקוי CISCO הזכוכית של עדשת המצלמה וחולונית יציאת הליזר יש לכבות את המכשיר ואך לנוקות את משטח הזכוכית בסודיות ובעדינות עד לפינוק.

7.2 מסך מגע

המכשיר כולל מסך מגע עמיד, המיועד לתפעול גם באמצעות כפות עבודה. המכשיר לא תוכנן לשימוש עם אביזרים להגנה על המסך. אפשר אמנים להשתמש באביזרים כאלה, אבל המכשיר לא נבדק בעבודה אתם וייתכן שהם ישבשו את התగובויות של מסך המגע.

◀ נגב את מסך המגע במטלית נקייה, שאינה שורטת, כדי שהוא ישאר מבריך ויגיב ל מגע שלך.

◀ אם מסך המגע נשבר, הפסיק להשתמש במכשיר ופנה לשירות של **Hilti**.

7.3 כוֹל חִיָּשׁן השיפוע

7.3.1 מרווחים בין כיולים

כדי להשיג מדידות מדויקות ככל האפשר בשיפוע יש לכידל באופן סדרי את חישון השיפוע. יש לכידל גם אם המוצר קיבל מכיה או נחשף לתנודות טמפרטוריה.

7.3.2 כוֹל חִיָּשׁן הנטייה

1. בתפריט 'פונקציות' בחר את האפשרות 'הגדרות' ו-'כוכן חישון השיפוע'.
 2. הנח את המכשיר על משטח מישורי כשהציג פונה כלפי מעלה.
 3. לחץ על לחצן המדידה.
 4. סובב את המכשיר בכיוון המנוגד, בלי להרים אותו מהמשטח שעליו הוא מונח.
 5. לחץ על לחצן המדידה.
- ▷ חישון השיפוע מכויל.

8 הובלה ואחסון

8.1 הובלה

- ◀ כדי להגן על ה-**CS-PD / PD-C** בעת הנשיאה וההובלה, השתמש בנוירטיק המכשיר שסופק על ידי **Hilti**.

8.2 אחסון

- ◀ אין לאחסן את המכשיר כשהוא רטוב. אפשר לו להתיבש לפני האחסון.
- ◀ הקפד לאחסן את הציזוד בתוך גבולות הטמפרטורה הדורשיות מצויין בנתונים הטכניים.
- ◀ לאחר אחסון ארוך או הובלה ממושכת של הציזוד יש לבצע מדידת בקרה.

9 תיקון תקלות

אם מתרכשת תקלה שאינה מוסברת בטבלה זו או שאיןך יכול לתקן בעצמך, פנה ל-**Hilti Service**.

תקלה	סיבה אפשרית	פתרונות
אי אפשר להפעיל את המכשיר.	טען את הסוללה המובנית.	ה솔לה התרוקנה.
	צורך קשר עם השירות של Hilti .	ה솔לה פגומה.

10 SHoR (תקנה להגבלת השימוש בחומרים מסוכנים)

בקישור הבא תמצא את טבלת החומרים המסוכנים: qr.hilti.com/r4890614.
קישור לטבלת SHoR נמצא בסוף תיעוד זה, בצורה קוד QR.

11 סילוק

החומרים של **Hilti** מיוצרים בחלקים הגדולים מחומרים ניתנים למיחזור. כדי שניכיתן יהיה למחזרים דרושה הפרדת חומרים מקצועית. במדיניות רבות **Hilti** מקבל את המכשיר הישן שלו בחזרה לצורך שימוש חוזר. פנה לשירות של **Hilti** או למשווק.

◀ אין להשליך כלី עבודה חמליים לפסולת הביתית!



12 אחריות יצרן

- ◀ אם יש לך שאלות בנוגע תנאי האחריות, פנה למשווק **Hilti** הקרוב אליך.

הערה

מ构思יר זה שמר בבדיקות על ערכי הגבול המוכתבים בחלק 15 של תקנות FCC למכשירים דיגיטליים מדירוג B. ערכי גבול אלה נועדו לספק הגנה טובה מפני קרינה מפריעה בעת עבודה באזורי מגוריים. מכשירים מסווג זה יוצרים ומרקינים תדרים גבוהים ומשתמשים בתדרים גבוהים. לפיכך אם מתקינים אותם או משתמשים בהם שלא בהתאם להנחיות הם יכולים לגרום להפרעות بكلיטת רדיו רדיו.

אולם לא ניתן להבטיח כי במצבים מסוימים לא יתרחשו הפרעות בכל זאת. אם מ构思יר זה גורם להפרעות بكلיטת רדיו או טלויזיה (כדי לדחות שדו אכן הבעה, ניתן לבנות ולהפעיל את המכשיר מחדש), יש לפתור את הבעיה בעדרת האמצעים הבאים:

- כוונן את האנטנה מחדש או הגדד אותה למקום אחר.
- הגדל את המרחק בין המכשיר למקלט.
- חבר את המכשיר לשקע של מעגל חשמלי שונה מזו של המקלט.
- פנה לעזרת משוק המכשיר או לעדרת טכני רדיו וטלוויזיה.

הערה

שינויים שלא אושרו במפורש על ידי **Hilti** עלולים להגביל את הזכות של המשתמש להפעיל את המכשיר.

התקן זה תואם את הנדרש בסעיף 15 של תקנות FCC ואת RSS-210 RSS של ה-ISED. לצורך הפעלה יש לעמוד בשני התנאים הבאים:

- מכשיר זה אינו רשאי ליצור קרינה מדיקה.
- המכשיר חייב לקЛОט את כל הקרינה, כולל קרינה הנגרמת מפעולות בלתי רצויות.

55	PDA 72
----------	--------

אפליקציות

54	החלפה
54	אפליקציה מדידה

59	בahirot
5453	בית

71 ,56	דיקן המדידה
5453	דף פתיחה

הגדרות

60	נקודות ייחוס למדידה
	הגדרות ייחוס
60	היסט
60	היסט
64	היעדרות במצולמה
57	השפעות פבי השטח

59	זום
59	דיהוי היעד
63	זיכרון הבזק

55	חוד מדידה
55	חישון שיפוע

64	טוח הגעה
64	טוח הגעה של המדידה

יצוא קבצים

63	באמצעות Bluetooth
----------	-------------------------

כיוול חיישן השיפוע 76, 66

כ

לוחות מטרה 64, 55

ל

לייזר

59, 54	סטנדרטי
59, 54	קבוע
59	לייזר סטנדרטי
59	לייזר קבוע

א

מאריך מדידה

55	ארוך
55	קצר

מדידה

59	בודדת
54	הפעלה
59	מרובה
54	סיום
71	עקיפה
59	מדידה בודדת
59	מדידה מרובה
68, 58	מדידה רציפה

מדידת מרחק

67	בודדת
54	מדידת תחום

54	מדדך
61	'Horizontal'
60	'Maximal'
60	'Minimal'
61	'אנכי'
58	השבתה (מצב רגל)
73	'טיב'/'מקס'/'דלתא'

מצלמת יעד 59, 54

בahirot 59

זום 59

79

עברית

מרחץ

71	אופקי
73	ההפרש בין המינימום למקסימום שנמדדתו
54	מרחץ נתון

ב

65	געילת המכשיר
----------	--------------------

נקודות

70	גלאי
60	נקודות ייחוס למדידה
54	נקודות ייחוס
59 ,53	נקודות לייזר
59	כיסוי עם צלב מיקוד

ס

50	סוללה בטענת, מובנית
54	סרגל כלים
54	סרגל ניוט

ע**עד**

60	היסט
58	מדנק מיבאים
58	מדנק, אופקי
58	מדנק, אובי
58	מדנק, מקסימום
58	מצלמת יעד
58	קוצב דמן

צ

59	צלב מיקוד
59	כיסוי עם נקודות לייזר

ר

54	רשימת כלי עבודה
----------	-----------------------

ש

57	שגיאות במדידה
65	שחרור בעילה

שיטח

70	מלבן
----------	------------

62	תוצאות המדידה
62	קיובלות הדיכרונות
62	תצוגה
	תיקיות פרויקט
63	לחצנים במסך
62	ניהול



Hilti Aktiengesellschaft
Feldkircherstraße 100
9494 Schaan | Liechtenstein

PD-C (01)

[2015]

2011/65/EU

EN ISO 12100

2014/53/EU

EN 60950-1

EN 60825-1

EN 62479

EN 301489-1 V2.1.1

EN 301489-17 V3.1.1

EN 300328 V2.1.1

Schaan, 05/2017

A handwritten signature in black ink, appearing to read "Paolo Luccini".

Paolo Luccini

Head of Quality and
Process-Management

BA Electric Tools & Accessories

Thomas Hillbrand

Head of BU Measuring Systems

Business Unit Measuring Systems

A handwritten signature in black ink, appearing to read "Thomas Hillbrand".



Hilti Aktiengesellschaft
Feldkircherstraße 100
9494 Schaan | Liechtenstein

PD-CS (01)

[2016]

2011/65/EU

EN ISO 12100

2014/53/EU

EN 60950-1

EN 60825-1

EN 62311

EN 50566

EN 62209-2

EN 301489-1 V2.1.1

EN 301489-17 V3.1.1

EN 300328 V2.1.1

Schaan, 05/2017

A handwritten signature in black ink, appearing to read "Paolo Luccini".

Paolo Luccini

Head of Quality and
Process-Management

BA Electric Tools & Accessories

A handwritten signature in black ink, appearing to read "Thomas Hillbrand".

Head of BU Measuring Systems

Business Unit Measuring Systems





Hilti Corporation
L1-9494 Schaan
Tel.: +423/234 21 11
Fax: +423/234 29 65
www.hilti.group

Hilti = registered trademark of Hilti Corp., Schaan



2140183

Pos. 1 | 20171123